

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in  
Machtac  
(County)

	Located In:	Corner Code :#
1. Public Land Survey	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S <u>33</u> T <u>43N</u> R <u>7W</u>	<u>9</u>
	S <u>33</u> T <u>43N</u> R <u>7W</u>	<u>7</u>
3. Miscellaneous Property in Sec.	S <u>33</u> T <u>43N</u> R <u>7W</u>	<u>5</u>
	S _____ T _____ R _____	_____

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

I, Stephan J. Szyszkoski, in a field survey on March 02, 1992, 19\_\_\_\_\_, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

**A. Description of original monument and accessories and/or subsequent restoration:**

- (9) East 1/16 corner, Section 33. Corner recorded by Billy D. Buckler in 1963 as being established and monumented midway and on a straight line between F12 and G12.  
 (7) Corner recorded by Billy D. Buckler as being established and monumented in 1963 midway and on a straight line between G11 and G12.  
 (5) Corner not established in original survey. Found no record of subsequent monumentation.

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

- (9) Found and accepted 1"x32" pipe with 4" aluminum tablet placed by Buckler in 1963. Top 12" of monument was bent westerly but remainder was vertical and set firmly in the ground. Aluminum tablet was intact. Buckler's 1963 W. Pine BT is dead. Removed and replaced found monument with a new monument.  
 (7) Found and accepted 1" pipe with 4" aluminum tablet placed by Buckler with his recorded BT (beech SE 33.5 links with base blaze and scribing) agreeing. Maple BT has been cut.  
 (5) Established and monumented the corner equidistant and on a straight line between F11 and F12. F11 is a computed position midway and on a straight line between adjacent regular section corners, and F12 is a monumented corner.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

- |  |  |  |
|--|--|--|
| (9) Set 1"x32" painted iron pipe with 4" cast aluminum NDNR tablet. S01E 4.4' nail and tag in 5" maple; N80E 5.6' nail and tag in 3" pine; N08E 16.0' nail and tag in 7" balsam; N62W 23.4' nail and tag in 8" jack pine. Blazed and scribed all above trees at BH and base. | (7) Found 1" pipe with 4" cast aluminum tablet. S80W 2.9' nail and tag in 8" maple; S31E 22.1' set nail and tag in 20" beech (obl); S73E 9.53' nail and tag in 5" maple; N74E 14.83' nail and tag in 3" beech. scribed obt at BH, scribed 3" beech "x" at BH, BT at base. Others blazed and scribed "1/16" at BH and "BT" at base. | (5) Set a 1"x32" painted iron pipe with a 4" cast aluminum NDNR tablet. S59W 7.31' nail and tag in 8" maple; N43W 19.8' nail and tag in 20" R. Pine; S45E 22.35' nail and tag in 7" maple; S04E 32.6' nail and tag in 18" R. Pine. Blazed and scribed all trees at BH ("N1/16") and base ("BT"). |
|--|--|--|

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	1	2	3	4	5	6	7	8	9	10	11	12	13
3													
4	7	8	9	10	11	12							
5													
6	13	14	15	16	17	18	19	20	21	22	23	24	25
7													
8	19	20	21	22	23	24	25	26	27	28	29	30	31
9													
10	30	31	32	33	34	35	36	37	38	39	40	41	42
11													
12	31	32	33	34	35	36	37	38	39	40	41	42	43
13													


Signed by \_\_\_\_\_

*Stephan J. Szyszkoski*

Date 3-16-92

Surveyor's Michigan License No. \_\_\_\_\_

33986

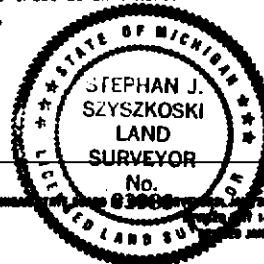

FORM APPROVED BY MICHIGAN BOARD OF LAND SURVEYORS, 1970  
 REVISED JAN. 1983