

83

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

MacKiac

(County)

Located In:

Corner Code #

1. Public Land Survey	T <u>43N</u> R <u>8W</u>	<u>J2</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S <u>2</u> T <u>43N</u> R <u>8W</u>	<u>3</u>
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

Aug 28 1995

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3					●	●		1	
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:

(J2) Center of Section 2. Corner not established in the original survey. Found no subsequent record.

(3-Sec. 2) North 1/16 corner between Sections 2-3. Corner not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(J2) Found no evidence of prior monumentation at the corner position. Established the corner at the intersection of straight lines connecting opposite 1/4 corners 2678.97' north, 2649.30' east, 2654.71' south, 2673.40' west. At the position for the corner, I placed a 1"IDx36" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped.

(3-Sec. 2) Found no evidence of prior monumentation at the corner position. Established the corner 20 chains, proportionate to the original record, north of the Quarter corner common to Sections 2-3 and on a straight line between the quarter corner and the Section corner common to Sections 2-3 T43N-R8W and 34-35 T44N-R8W. The corners are 1343.08' south and 1362.55' north. At the position for the corner I placed a 1"IDx36" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(J2) Set 1" pipe with 4" MDNR cap.

Blazed, scribed, and set measuring nails

in the following bearing trees:

12" R. Pine N43E 7.5' "CS BT"

3" Maple N34W 27.95'

14" R. Pine N76W 27.1'

4" W. Birch S80E 27.0'

Placed a 7" cedar post adjacent.

Bearings are magnetic.

(3) Set 1" pipe with 4" MDNR cap.

Blazed, scribed, and set measuring nails

in the following bearing trees:

5" Maple N71W 6.75' "N1/16 BT"


6" Ironwood North 8.6'

4" Maple N54E 13.5'

5" Maple S02E 14.6'

Placed a 5" squared cedar post adjacent.

Bearings are magnetic.

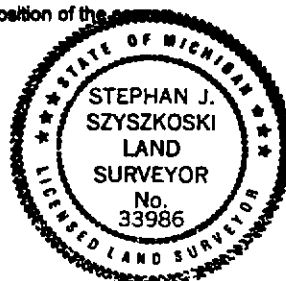

Signed by

Stephan J. Szyszkoski

Date

11-28-95

Surveyor's Michigan License No.

33986

For the Michigan Department of Natural Resources - Forest Management Division