

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

Mackinac Co.

2 Corners.

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>43</u> N. <u>5</u> R. <u>12</u> W.	I-7, K-7
2. PROPERTY CONTROLLING IN SECTION _____	, T. _____ S. _____ R. _____ W. _____	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	, T. _____ S. _____ R. _____ W. _____	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 6-30, 1980, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Corners set by Guy Carlton Jr. D.S. in 1849. Bearings were:

- I-7 Sec. Cor. common to Sec's. 14-15-22-23. Aspen 20", N80°E, 12 lks.
Cedar 6", N83°W, 25 lks.
- K-7 Sec. Cor. common to Sec's. 13-14-23-24. Alder 3", S45°W, 8 lks.
Alder 4", S15°E, 10 lks.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:


- I-7 Restored corner by double proportionate measure between corners in all four directions. No evidence of original corner could be found.
- K-7 Restored corner on South edge of Mitten Lake by Double Proportionate Measure. Corner serves as a section corner and also a Meander Corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Placed 1" pipe with 4" aluminium cap at both corners. New bearings are:

- I-7 6" Cedar (S15 NBT), N20°W, 24.0' & 12" Cedar, (S22 NBT), S44°W, 40.9' & 10" Hemlock, (S23 NBT), S33°E, 57.9'.
- K-7 6" Ash, (S23 NBT), S10°W, 67.1' & 8" Ash, (S23 NBT), S44°W, 85.7'.

SIGNED BY Billy D. Buckler DATE 7-30-80
 Billy D. Buckler
 SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

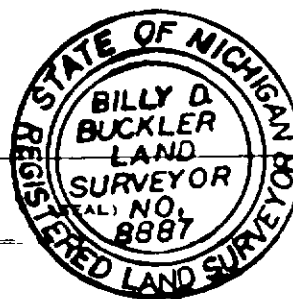

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY
 APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR (SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

FORM APPROVED BY MICHIGAN STATE BOARD OF REGISTRATION, JAN. 28, 1971
 REVISED MAY 14, 1975

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET