

SURVEY &
REMONUMENTATION

FEB 18 1994

COMMISSION LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Mackinac

(County)

Located In:

Corner Code #

- | | | | | |
|------------------------------------|---|-------------|-----------|------------|
| 1. Public Land Survey | T | <u>43NR</u> | <u>2W</u> | <u>A-3</u> |
| | T | _____ | _____ | _____ |
| | T | _____ | _____ | _____ |
| | T | _____ | _____ | _____ |
| 2. Property Controlling in Section | S | _____ | _____ | _____ |
| | S | _____ | _____ | _____ |
| 3. Miscellaneous Property in Sec. | S | _____ | _____ | _____ |
| | S | _____ | _____ | _____ |

RECEIVED & FILED
DIANE GRAPKOVICH
MACKINAC COUNTY REGISTER OF DEEDS

DEC 07 1993
AM _____ PM
7/8/91 10/11/91 12/13/91 1/4/92 1/5/92

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

Neil E. Hill

October 1 93

I, _____, in a field survey on _____, 19____, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1840: Established by Austin Burt, in the original government survey of the range line T43N, R02-03W.
Marked a 8" Fir as corner tree and established the following references:
12" Fir S32W 11 Links

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

1986: ECI, no original cor. evidence recovered. Remains of ancient fence, 95% down, found 1200' (more/less) West, support the N-S Corner position. Measurements from the cor. to R.H. bank of the Pine River do not agree closely with record GLO distances from James Mullet's 1845 subdivision of Sec. 6, T43N, R2W. (26-ECI: 45.5-GLO). This call was given little weight due to the facts that it was on a random line, made to L.H. bank & showed the stream as 1.3 chains wide with no mention of R.H. bank. Corner position established at proportionate distance from the E-1/4 Cor. of Sec. 1 on line through the third WMC to the South which was established from an apparent recovered original bearing tree.

1986: A.K. Pierce, LS #30097, set a 2-1/2" O.D. x 4' long galvanized iron pipe with a plastic flanged base and capped with a 3-1/4" bronze tablet stamped to identify the corner. Bearing trees are blazed, scribed, painted & tagged, with distances being measured from an aluminum nail in the side of the trees: Post North 2.5' 15" Spruce S54W 59.48'
8" Basswood N44E 13.90' 6" Basswood S16E 42.78' 6" W. Birch N37W 35.99'

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

1993: Found a 2-1/2" O.D. galvanized iron pipe and capped with a 3-1/4" bronze tablet stamped to identify the corner. Following witnesses were found: bearing trees blazed, scribed, painted and tagged; distances measured from an aluminum nail in the side of the trees: Post North 2.5' 15" Spruce S54W 59.48'
8" Basswood N44E 13.90' 6" Basswood S16E 42.78' 6" W. Birch N37W 35.99'


1993: Upon review, the location and witnesses for the corner as recorded in Liber C-133 (Corner Records), are sufficient to perpetuate corner location.

Signed by Neil E. Hill P.S.P.C.

Date October 15, 1993

Surveyor's Michigan License No. 27447

Re monumentation Surveyor
D-0226

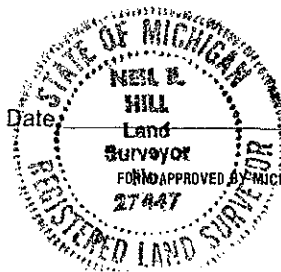

REVISÉ JAN., 1983