

68

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Mackinac _____ (County)	Located in:	Corner Code #
1. Public Land Survey	T 44N R 11W	M5
	T 44N R 11W	L5
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous	S _____ T _____ R _____	_____
Property in Sec.	S _____ T _____ R _____	_____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

Aug 19 1998

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5												●	●
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

(M5) Corner common to Sections 12-13 T44N-R11W and Sections 7-18 T44N-R10W. Corner reestablished in 1980 by Billy D. Buckler, RLS: "Placed corner at intersection of county roads to North, South and West. Found no other evidence. This position appears to agree with old blazed lines in this section. Buried 36" "T" iron in road. 8" H. Maple N38W 62.8', 10" Beech N54E 71.9', 10" Y. Birch S67E 42.6".

(L5) Quarter corner common to Sections 12-13. Corner reestablished in 1980 by Billy D. Buckler, RLS: "Placed corner midway and on line bet. two section corners. Buried 36" "T" iron in center of East-West road. 10" H. Maple S23W 57.0', 14" H. Maple N72E 69.8', 16" H. Maple N09E 54.5'".


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(M5) The 1980 monument was not recovered. Re-monumented the corner at record bearing and distance from the three 1980 witnesses, all recovered in good condition with scribing visible. At the position for the corner, I placed a 1"10 x 36" iron pipe capped with a yellow plastic cap stamped "MICH DNR PS 33986". Placed measuring nails in the 1980 witnesses as described below. Corner placed and witnessed by T.Stark and M.Feldpausch, Newberry District Office.

(L5) Recovered the 1980 monument, as described, in good condition, and at record bearing and distance from the 1980 accessories. My measurements show the monument to be 0.12' West and 0.38' South of the record position. I accept the monument as a careful and faithful reestablishment of the position of the original corner. Left the monument in place, placed measuring nails in the 1980 witnesses and re-marked the top blaze on the Maple S23W. Corner recovered and re-witnessed by T.Stark and M.Feldpausch, Newberry District Office.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(M5) Set 1" pipe with plastic RLS cap.	(L5) Found "T" iron. Set measuring
Set measuring nails in the 1980	nails in the 1980 witness trees:
witnesses:	14" Maple N11E 55.45'
10" Maple N36W 63.25' (1980 wit)	18" Maple N75E 70.35'
12" Beech N56E 72.8' (1980 wit)	14" Maple S25W 57.05' "1/4S"
12" Y. Birch S65E 42.95' (1980 wit)	Power Pole #540 S56E 74.1'
Hayes Road Sign N56W 24.8'	Bearings are magnetic.
Bearings are magnetic.	

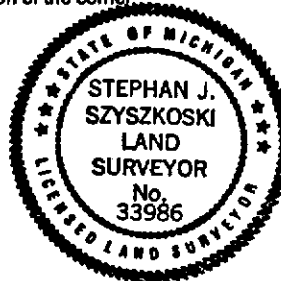

Signed by Stephan J. Szyszkoski
Surveyor's Michigan License No. 33986

Date 11/18/98

For the Michigan Department of Natural Resources - Forest Management Division