JAN 21 1999

SECTION

For corners in

## LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

Mackinac County Remonumentation Corner

	or conners in						
ı	Mackinac County		Located	in:		Corner Code #	
	1. Public Land Sur	vey		T44N T45N T	R11W R11W R R	G-13 (Luce Co.)	
1	2. Property Contro	lling 8	S	Ť	R		
	in Section		S	T	R		ĺ
	3. Miscellaneous	(	S	T	R		İ
	Property in Sec.	(	3	T	R		ĺ
4	4. Lot No.	, Record	ed Plat		ACCEPTE SURVEY I	D BY THE MACKINAC CO PEER GROUP AS THE	ΗH

RECEIVED DIANE FRANKOVICH ALMAN DAVIELE OF DEBUG

DEC 3 1 1998

AM PM 71819110111112111213141516


Register of Deeds Stamp & File Number

5. Private Claims

SURVEY PEER GROUP AS THE OFFICIAL CORNER UNDER PA. 345 OF 1990 AT A MEETING HELD ON 11-50-48

I, William L. Karr, in a field survey on December 2, 1998, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

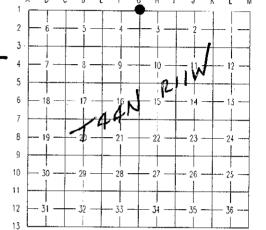

A. Description of original monument and accessories and/or subsequent restoration:

(G-1) Section Corner Common to Sections 33 & 34, T. 45 N., R. 11 W. and Sections 3 & 4, T. 44 N., R. 11 W.

1841 John Burt set a post for the corner in the original survey.

Witnesses:

7" Tamarack 8" Tamarack

N 34° E N 44° W

14 lks 32 lks

Could find no subsequent history on this corner in the available public records.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(G-1) Section Corner Common to Sections 33 & 34, T. 45 N., R. 11 W. and Sections 3 & 4, T. 44 N., R. 11 W. This corner is being perpetuated as part of the Luce County Remonumentation Program.

Found probable evidence of the original 8" Tamarack B.T. Found a hollow tamarack stump with evidence of a base blaze at the proper location. Could find no evidence of the tamarack to the Northeast or of the original post. The position for the corner works well with other recovered evidence along the township line. Re-established the corner position at the record bearing and distance from the B.T. stump.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(G-1) Section Corner Common to Sections 33 & 34, T. 45 N., R. 11 W. and Sections 3 & 4, T. 44 N., R. 11 W.

Corner is a 1/2" x 48" re-bar with a stamped Luce County Remonumentation cap. The corner falls in a very wet, partially flooded area.

Witnesses:

Cedar Post North 1.0' Cedar 8" N 78° E 12.321 Tamarack 8" S 57° E 22.80 Cedar 7" N 89° W 10.041 Cedar 8" N 16° W 18,11 Charred remains of rubber boots

30' +/-West

Bearings are compass bearings, corrected for declination, all distances are to a nail and tag in the side of the otherwise noted.

Signed by Surveyor's Michigan License No. 27450

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971 REVISED MAY 14, 1975 REVISED JAN., 1983 REVISED OCT., 1995

ILLIAM

KARR

LAND SURVEYOR