

**SURVEY &  
REMONUMENTATION**

1993

**LAND CORNER RECORDATION CERTIFICATE**  
Filing Requirement of Act 74, Mich. P.A. 1970

**COMMISSION**

For corners in  
Manistee

(County)

Located In: \_\_\_\_\_ Corner Code # \_\_\_\_\_

- |                                    |   |     |   |     |               |
|------------------------------------|---|-----|---|-----|---------------|
| 1. Public Land Survey              | T | 21N | R | 13W | E-1           |
|                                    | T |     | R |     |               |
|                                    | T | 22N | R | 13W | <u>E-13</u> ✓ |
|                                    | T |     | R |     |               |
| 2. Property Controlling in Section | S |     | T |     | R             |
|                                    | S |     | T |     | R             |
| 3. Miscellaneous Property in Sec.  | S |     | T |     | R             |
|                                    | S |     | T |     | R             |

REGISTER'S OFFICE  
MANISTEE COUNTY  
#93-363 AT 11:37 A.M.  
**MAY 24 1993**

*Penny A. Pepera*  
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

Norman C. Caldwell \_\_\_\_\_, in a field survey on \_\_\_\_\_, September \_\_\_\_\_, 1992

do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

**A. Description of original monument and accessories and/or subsequent restoration:**

E-1 Position established by J. Brink Oct. 11, 1837. Position falls in river. Post established on bank of river 5.40 ch. (356.40') East of position.  
N6½°E 28 lks. (18.48') 18" W. Pine  
S68½°E 27 lks. (17.82') 11" Lynn

Post established on bank of river 1.50 ch. (99') West of position.  
N8½°E 20 lks. (13.20') 8" Hemlock  
S27½°W 23 lks. (15.18') 13" Y. Pine

Orange Ridson, 1847, 10" W. Birch on left bank of Manistee River was marked for meander corner 10.17 ch. (671.22') South of corner.

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

E-1 Sec. cor. 4 & 5, T21N-R13W

Survey by Fargo Eng. Co. July & August 1909, no U.S. evidence.  
Witness cor. 3.00 ch. (198.00') West of Corner  
N20°W 1.77½ ch. (117.15') 14" B. Ash  
S58°E 0.85 ch. (56.10') 8" Poplar

Witness cor. 3.00 ch. (198.00') North of corner  
S33½°W 0.40 ch. (26.40') 8" W. Oak  
N78°W 0.56 ch. (36.96') 7" W. Oak


Recorded survey by Richard L. Mays in Liber 1, page 742 indicates a position for this corner and was established using improper procedures and is not utilized in the course of this survey.

Unrecorded survey by Anthony M. Slawinski, March 1970 indicates a position for this corner and was established using improper procedures and is not utilized in the course of this survey.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

E-1 Sec. cor. 4 & 5, T21N-R13W

Position falls in back waters of Tippy Dam. No monument placed. Utilized record position by original gov't. survey and Fargo Eng. Co. by single porportion between record position of NE cor., Sec. 6, T21N-R13W and recovered original NE cor. Sec. 4, T21N-R13W and is accepted as a careful and faithful reestablishment of the position of the corner.

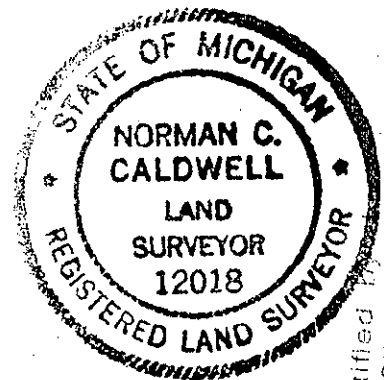

Peer Group ratified by \_\_\_\_\_  
is amended by P.A. 345 of 1993  
Date of Peer Review: \_\_\_\_\_

Signed by Norman C. Caldwell

Date 12 JAN 93

Surveyor's Michigan License No. 12018