

DEC 11 1999

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

SECTION

For corners in

<u>Manistee</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>22N</u> R <u>15W</u>	<u>M-11</u> SE cor. Sec. 25 ✓
	T <u>22N</u> R <u>14W</u>	<u>A-11</u>
	T ___ R ___	_____
	T ___ R ___	_____
2. Property Controlling in Section	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____

REGISTER'S OFFICE
MANISTEE COUNTY
99-327 at 4:05 pm
SEP 29 1999
Dabovich
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

I, Bruce J. Jenema, in a field survey on April 29, 19 99 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, reestablished, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

M-11 T22N, R15W (SE corner Section 25) Common to A-11 T22N, R14W

1837 J. Brink, D.S. GLO
Set Post
1.) 16" W. Pine S63°W 40 links (26.40')
2.) 10" Hemlock N63°W 12 links (7.92')

1909 Fargo Engineering
Rec. C.S. Book A, page 131 & Bk 1 pg 118
No U.S. evidence
3.) 16" W. Oak S84°E 0.62 ch. (40.92')
4.) 6" R. Oak S62 3/4°W 0.41 ch (27.06')

1980 G.A. Fauser (C.P. Co)
Rec. Liber 1, page 809 of surveys
Found 1" pipe Set by Fargo
5.) 13" R. Pine S70°E 33.30'
6.) 23" W. Oak S80°E 48.65'
7.) 25" W. Pine S05°E 23.37'
8.) 12" R. Pine S10°W 27.09'

1986 A.M. Slawinski
Unrecorded
Found Iron pipe
No reference given

Witnesses 1,2, & 4 are now extinct Witnesses 3 & 6 maybe the same

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


On April 29, 1999, I found a 1 1/4" iron pipe hooked at the base and lime deposited by Fargo Engineering and witnesses: 5.), 6.), 7.), & 8.)

No conflicting evidence of other corners existing.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

On July 14, 1999, I placed a standard Manistee County Monument in the exact position of the above 1" iron and is accepted as the best available evidence of the position of the original corner and witnessed by:

5.) 15" R. Pine S70°E 33.50' Found Nail & washer N. side
6.) 26" W. Oak S80°E 48.65' Found Nail & washer N. side
7.) 26" W. Pine S05°E 23.37' Found nail E. side Set 60-D spike in same location
8.) 16" R. Pine S10°W 29.00' Nail E. side
9.) 14" W. Oak S75°W 21.41' Set 60-D N. side
This position is approximately 300' E-S-E from Indian Village Road at a curve to the West and 30' North from the base of a steep bluff

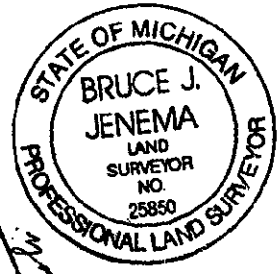

Certified by the Manistee County Peer Group
 according to the county plan adopted pursuant to P.A. 345 of 1999
 after being the State Survey and Remonument Act, MCL 54.251
 Date of Peer Review: Sept 17 1999
 Peer Reviewer: [Signature]

Signed by Bruce J. Jenema
Surveyor's Michigan License No. 25850

Date 9-16-99