

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

**MASON** (County) Located In: Corner Code *11*


1. Public Land Survey T 17N R 17W J-3  
 T R  
 T R  
 T R

2. Property Controlling S T R  
 in Section S T R

3. Miscellaneous S T R  
 Property in Sec. S T R

4. Lot No. Recorded Plat

5. Private Claims

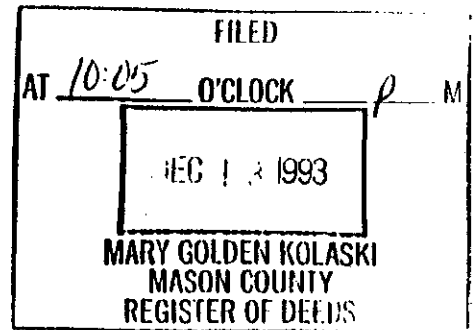

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2				
3										1			
4	7		8		9		10		11		12		
5													
6	16		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

I, **John Schulke**, in a field survey on **Nov. 3**, 1993 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

**A. Description of original monument and accessories and/or subsequent restoration:**

In 1838, Hogenson established a 10" beech tree as the corner. No other corner ties.  
 In 1880, C.E. Mitchell recovered corner established by P. Eastman. Road survey of North-South 1/4 line of Section 11 (see Mason Co. Surveyor Book 1, page 103). No references.  
 In 1888, Metcalf recovered corner by testimony and indicated stone at corner. No references.

In 1988, K. Ross surveyed in Section 11 (see Liber 374, page 6 in the Mason Co. Register of Deed's Office). The following corner references:  
 Maple 4" S23°W 112.6 ft.  
 Maple 8" S64°W 78.2 ft.  
 Road sign S51°W 39.2 ft.


**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

Found 1/2" dia. rebar bent and the following bearing trees:  
 Sug. Maple 6" S23°W 112.4 ft.  
 Sug. Maple 8" S64°W 78.3 ft.  
 Road sign S51°W 39.2 ft.  
 Accepted recovered rebar as the best available evidence of the perpetuated location of the original corner.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

Replaced 1/2" rebar with 5/8" dia. X 24" iron rebar with an aluminum County cap stamped to identify the corner. The following corner references:  
 Stop sign S20°E 46.52 ft.  
 Power pole S63°E 173.62 ft.  
 NW corner of house S72°W 188.87 ft.  
 SW corner of house N62°E 222.98 ft.

Note; Rebar 1 foot below the surface of the road.

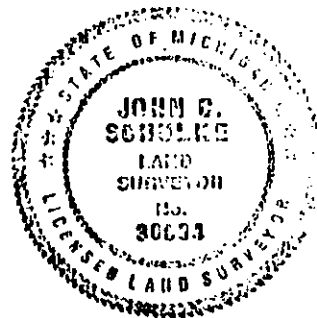

Peer Group Reviewed and Approved  
 Date: 12-13-93  
 Mason County Surveyor

Signed by *John C. Schulke*  
 Surveyor's Michigan License No. **RLS-30894**

Date *Dec. 12, 1993*