


MAY 07 1997

COMMISSION

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>MASON</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T 18 N R 15 W	D-11
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

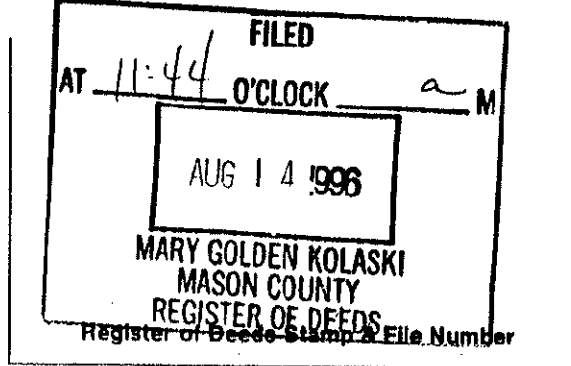

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, Sammy S. Barnett, in a field survey on July 17, 1996, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:

D-11 1/4 Corner for Sections 29 and 32, T18N, R15W.

Sylvester Sibley, 1838, G.L.O.

Set Wood Post

#1 Pine 12" N43°W 371ks.(24.42')

#2 Pine 12" S41°E 291ks.(19.14')

Sammy S. Barnett, RLS#16923, 1972

Set angle Iron

#3 White Oak 8" N51°W 30.38'

#4 White Oak 6" S32°W 15.65'

#5 Red Oak 10" N64°E 38.28'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

D-11 1/4 Corner for Sections 29 and 32, T18N, R15W.

On July 17, I found a standard concrete plat monument with R.L.S. cap, ROSS, # 17634, also found several pine stumps, but could not reestablish G. L. O. witnesses. I found no evidence to dispute this location for the corner.

Condition of recorded witnesses are;

- #1 Did not locate
- #2 Did not locate
- #3 Found in good condition
- #4 Found in good condition
- #5 Found in good condition

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

D-11 1/4 Corner for Sections 29 and 32, T18N, R15W.

I place a 2 1/2" aluminum cap, over the top of existing re-rod, stamped Mason County Monument, concrete monument is 0.4' above ground surface, and is accepted as a careful and faithful reestablishment of the position of the original corner.

- (ext. BT #3) White Oak 12" N 51° W 30.38'(60d spike in NW side of tree)
- (ext. BT #4) White Oak 10" S 32° W 15.65'(60d spike in SW side of tree)
- (ext. BT.#5) Red Oak 16" N 64° E 38.28'(60d spike in SE side of tree)
- White Oak 6" S 18° E 31.00'(60d spike in NE side of tree)

Signed by Sammy S. Barnett

Date 8-17-96

Surveyor's Michigan License No. 16923

Peer Group Reviewed and Approved  
Date: 8-13-96  
Kenneth L. Ross  
Mason County Surveyor

