

SURVEY & REMONUMENTATION

OCT 30 1996


COMMISSION

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>MASON</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T 18 N R 15 W	E-10
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

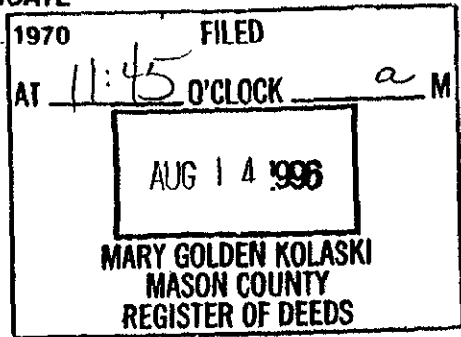

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Sammy S. Barnett, in a field survey on July 17, 1996, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:

E-10 1/4 Corner for Section 28 and 29, T18N, R15W

Sylvester Sibley, 1838, G.L.O.

Set Wood Post

#1 White Oak 14" N10°E 441ks.(29.04')

#2 Pine 24" S40°W 461ks.(30.36')

C. Landon, no date

monument not given

#11 W. Pine 25" S42°W 621ks.(41.25')

#12 W. Oak 10" N48°W 351ks.(32.10')

Sammy S. Barnett, RLS # 16923, 1972

Found 3/4" Iron Pipe

#3 Oak 8" S53°E 6.70'

#4 Oak 12" N22°E 22.43'

#5 Oak 4" S82°W 13.18'

Ken Ross, RLS #17634, 1977

Found 3/4" Iron pipe, raised w/ 1" Iron Pipe

#6 White Oak 8" S75°E 6.76'

#7 White Oak 10" N10°E 22.51'

#8 White Oak 6" Due West 13.31'

Mason County Road comm. no

date Iron

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

#9 W. Oak 8" N57°E 40.92'

#10 W. Oak 12" N40°W 38.94'

E-10 1/4 Cornr for Section 28 and 29, T18N, R15W

On July 17, I found a 1" Iron Pipe over a 3/4" Iron Pipe, I found no evidence to disputed this location for the corner.

Condition of recorded witnesses are;

#1 Gone

#2 Found Pine stump at S 40° W, 34 feet, note; could not define as G.L.O. witness

#3 Found in good condition

#4 Found in good condition

#5 found in good condition

#6 Same as 3

#7 Same as 4

#8 Same as

#9 Found in good condition

#10 GONE

#11 Found stump

#12 SAME AS #10

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

E-10 1/4 Corner for Sections 28 and 29, T18N, R15W

I replaced 3/4" Iron pipe, in the exact loction with a Standard Mason County Monument, flush with the surface of the ground, and is accepted as a careful and faithful reestablishment of the position of the original corner.

(ext. RT #3) White Oak 11" S 57° E 6.87'(60d spike in NE side of tree)

(ext. BT #4) White Oak 16" N 22° E 22.43'(60d spike in SW side of tree)

(ext. BT #5) White Oak 7" S 82° W 13.30'(60d spike in SE side of tree)

White Oak 14" N 74° E 33.94'(60d spike in SE side of tree)

Signed by Sammy S. Barnett


urveyor's Michigan License No. 16923

Date 8-12-96

Peer Group Reviewed and Approved

Date: 8-15-96

Kenneth L. Ross
Mason County Surveyor

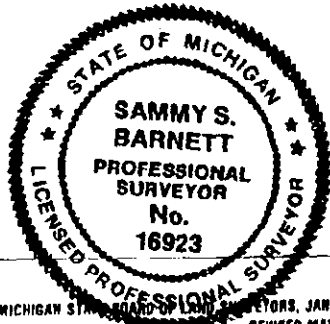

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1993