

DEC 29 1998

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

SECTION

For corners in

MASON (County)

Located In:

Corner Code #

1. Public Land Survey

T 18N R 16W

A-8

T 18N R 17W

M-8

T R

T R

2. Property Controlling in Section

S T R

S T R

3. Miscellaneous Property in Sec.

S T R

S T R

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

FILED
AT 10 O'CLOCK 21 A M
11
MARY GOLDEN KOLASKI
MASON COUNTY
REGISTER OF DEEDS
Register of Deeds Stamp & File Number

I, Kenneth L. Ross, in a field survey on August 24 19 98, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

A-8 1/4 Corner for Section 19, T18N-R16W and Section 24, T18N-R17W.

1838, Mullett and Brookfield, G.L.O. boundary survey

Set Wood Post

#1 Beech 10" N 32 W 22 lks. (14.52')

#2 Beech 12" S 63 W 27 lks. (17.82')

no date, Mason Co. Road Comm. (Land Corner Record)

Found Boat spike

#3 Tele-phone Pole NEE 29.18'

#4 Fence Corner Post East 67.00'

#5 Fence Corner Post SE 59.40'

1963, Kenneth Stephens, RLS, Mason Co. surveyor

set Rail-Road spike, at split between controlling

Corners. (file no. E-47), Note he shows the location

to fit the C-L of existing Lane (two-track).

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

A-8 1/4 Corner for Section 19, T18N-R16W and Section 24, T18N-R17W.

On August 24, 1998, I found a monument box in the center-line of Scottville Road, with the Top frozen on, I dug-out monument box to get iron. I found a 3/4" iron bolt for the corner, bolt was 2.2 feet East of the center-line of paved road. I found no evidence to dispute this location for the corner.

Condition of record witnesses are as follows; #1 Gone #2 Gone #3 Gone #4 Gone

#5 Found in poor condition

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

A-8 1/4 Corner for Section 19, T18N-R16W and Section 24, T18N-R17W.


I replaced frozen monument box with a Harrison cast iron monument, stamped MASON COUNTY MONUMENT, monument was placed in the exact location of the 3/4" bolt. This corner is accepted as correct and faithful re-establishment of the position of the original corner. I took four new witness.

#6 Black Ash twin 10"-13" N 88 E 56.38' (60d spike in South side of tree)

#7 Black Ash 6" S 57 E 66.83' (60d spike in SW side of tree)

#8 Maple 6" N 46 W 52.73' (60d spike in NE side of tree)

#9 Black Ash 8" S 35 W 64.57' (60d spike in SE side of tree)

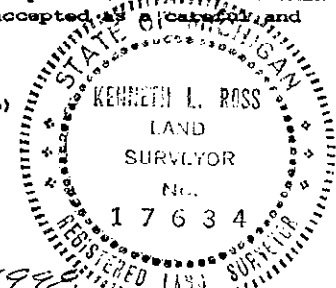

Signed by *Kenneth L. Ross*

Date *Sept 8, 1998*

Surveyor's Michigan License No. 17634

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983
ADAPTED FOR WORD PROCESSING MARCH, 1993

Kenneth L. Ross