

SURVEY & REMONUMENTATION


MAY 07 1997

COMMISSION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Mason (County)	Located In:	Corner Code #
1. Public Land Survey	T 18N R 17W	I-08
	T R	
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	

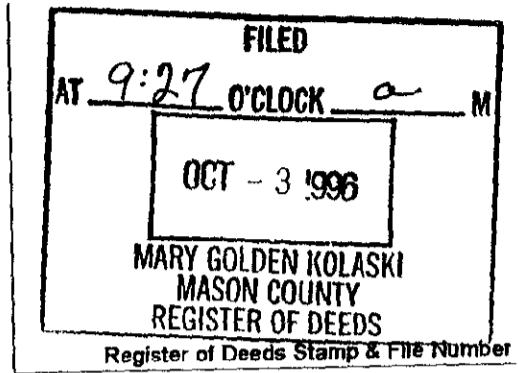

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Sammy S. Barnett, in a field survey on Sept. 1996 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	I
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:
I-08 1/4 corner common to Sections 22 & 23, T18N, R17W (Amber)

- 1838 Syl. Sibley G.L.O. #6 Twin Beech 9" S49W 42.0'
- Set Post 1972 J. Borsfay M.C.R.C.
- #1 Beech 14" N28E 19 lks. (12.54') Found 1/2" pipe under stone 2' deep
- #2 Beech 12" S36W 37 lks. (24.42') #7 Twin Beech 15"-24" S49W 42.26' (#6)
- Undated M.C.R.C 1/2" pipe under stone #8 Maple 28" N18-20'E 97.11' (spike)(#3)
- #3 Maple 28" N18-20'E 96.6' #9 Beech 20" E. 41.01' (spike)
- #4 Cherry 28" N17-30'W 109.5' 1974 Barry G. Krebs B.L.M.
- #5 F. Corner W. 33' Found 1" pipe in C/L Amber Rd. No witnesses

1990 & 1996 K. Ross
Raised iron with PK nail
No witnesses

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I-08 1/4 corner common to Sections 22 & 23, T18N, R17W (Amber)
On Sept. 6, I found 1" iron in existing monument box, I found no evidence to dispute this location. Condition of recorded witnesses are: # 9 Beech 22" S85E 41.48' spike in N. side

- # 1 Gone
- # 2 Gone
- # 3 Maple 48" N18E 98.52' added spike in E. side
- # 4 Gone
- # 5 Gone
- # 6 Twin Beech 18" & 26" S49W 41.40' added spike in NW side
- # 7 Same as # 6
- # 8 Same as # 3


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
I-08 1/4 corner common to Sections 22 & 23, T18N, R17W (Amber)

I replaced the 1" iron, in the exact location, with a Standard Mason County Monument in the existing monument box and accepted this location as a careful and faithful reestablishment of the position of the original corner.

- # 3 Maple 48" N18E 98.52' spike in E. side
- # 6 Twin Beech 18" & 26" S49W 41.40' spike in NW side
- # 9 Beech 22" S85E 41.48' spike in N. side
- # 10 Maple 10" S73E 80.85' Spike in SE side

Signed by Sammy S. Barnett
Surveyor's Michigan License No. 16923

Date 9-24-96

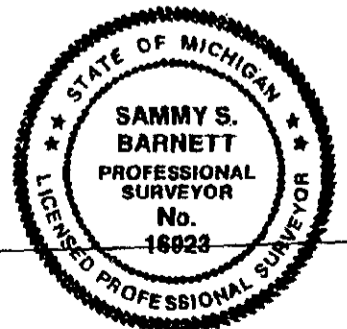

Peer Group Reviewed and Approved
Date: 9-30-96
Kenneth L. Ross
Mason County Surveyor

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983
REVISED OCT., 1995