

SURVEY & REMONUMENTATION

JAN 23 2001


LAND CORNER RECORDATION CERTIFICATE

SECTION

Filing Requirement of Act 74, Mich. P.A. 1970

For corners In: Located In: Corner Code #
Mason County

- 1. Public Land Survey T 18N R 16W A-3
T 18N R 17W M-3 ✓
T R
T R
- 2. Property Controlling S T R
in Section S T R
- 3. Miscellaneous S T R
Property in Sec. S T R
- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____

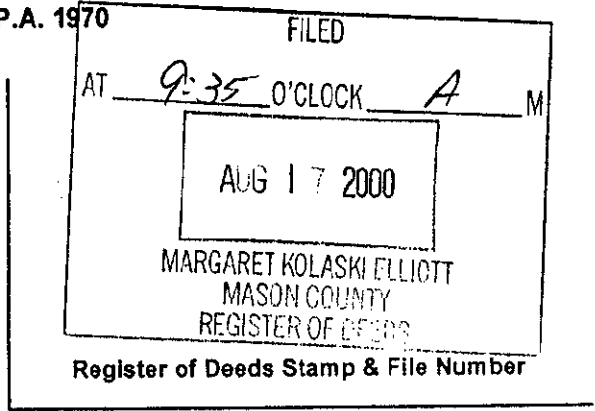

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3	7	8	9	10	11	12							
4													
5	18	17	16	15	14	13							
6													
7	19	20	21	22	23	24							
8													
9	30	29	28	27	26	25							
10													
11	31	32	33	34	35	36							
12													
13													

I, Kenneth L. Ross in a field survey on June 14, 2000, Do hereby certify that under requirements of P.A.74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

Section corner common to sections 6 and 7 of T18N, R16W and sections 1 and 12 of T18N, R17W.

A. Description of original monument and accessories and/or subsequent restoration:

GLO Mullett & Brookfield 1838
Poss. cor. sec. 1 and 12 is a Beach 24"
No witnesses taken.

Stephens RLS 7318
Unrecorded surveys in 1959 and 1968
Ex. iron in mon. box
No witnesses taken.

Slawinski for MDOT
1973
PP S60E 76.50' #1
PP N45W 71.93' #2
PP S60W 98.63' #3

Ross RLS 17634
Unrecorded surveys in , 1971, & 1977
Iron in mon. box, no witnesses taken

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I found a 5/8" iron rod in a monument box on the centerline of N-S and E-W roads.


Condition of the accessories: 1, 2, and 3 are gone.

I found nothing to dispute the location of this corner

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I set a 2 1/2" aluminum cap stamped "Mason County Monument 17634" on the existing 5/8" iron rod in a monument box and accepted this as a careful and faithful reestablishment of the position of the original corner.

- PP S75W 121.60' set mag nail N side
- PP N50E 62.40' ex RR spike on W side
- PP S80E 178.07' set mag nail N side
- PP S 51W 68.32' set mag nail N side

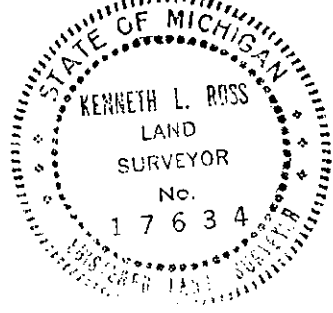

Signed by [Signature] Date 8-10-2000
Surveyor's Michigan License No. 17634

Approved by Peer Review Group on 8-10-2000
Kenneth L. Ross, County Representative [Signature]

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1978
REVISED JAN, 1983
ADAPTED FOR WORD PROCESSING MARCH, 1993