

**SURVEY & REMONUMENTATION**

**JAN 23 2001**


**LAND CORNER RECORDATION CERTIFICATE**

Filing Requirement of Act 74, Mich. P.A. 1970

**SECTION**

For corners In: Located In: Corner Code #  
Mason County

Public Land Survey	T 18N	R 18W	M-6
	T 18N	R 17W	A-6
	T	R	
	T	R	
Property Controlling in Section	S	T	R
Miscellaneous	S	T	R
Property in Sec.	S	T	R

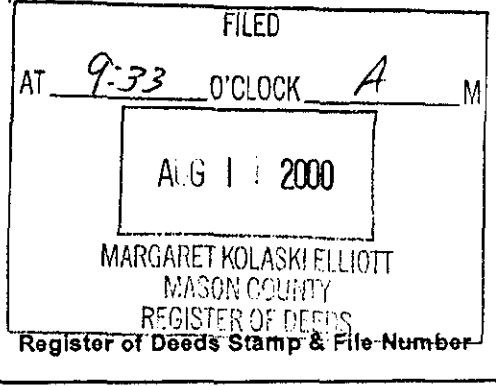

Lot No. \_\_\_\_\_ Recorded Plat \_\_\_\_\_  
Private Claims \_\_\_\_\_

Kenneth L. Ross in a field survey on June 14, 2000, Do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

NOTE: 1/4 corner common to section 18 of T18N, R17W, and Section 13 of T18N, R18W

**Description of original monument and accessories and/or subsequent restoration:**

Bullett & Brookfield 1/4 sec. post is a pine 14" no witnesses taken.	Fluharty PLS 18223 Liber 1 page 315 Fd. 1" iron in mon. box PP S40E 55.50' #1 PP N35E 48.78' #2 Support Pole N35W 60.54' #3
Stephens RLS 7318, June 1954 existing concrete monument no witness taken.	Hooth RLS 7966 Jan. 27, 1977 L1 P319 Act 74 1" pipe in Mon. Box in intersection PP N35E 48.81' #2 TP N35W 60.55' #3 TP S35W 39.50' #5 PP S40E 55.51' #1
E Mitchell 1883 B1 P140 1883 stump to Govt. wit. trees	MCRC undated PP N43W 56.4' #7 30" Elm S54E 31.9' #8 TP S33W 38.5' #6
Ross RLS 17634, iron in mon. box. Act 74 Liber 1 page 253 no witnesses taken	

**Description of corner evidence found and/or method applied in restoring or reestablishing corner:**


found a 1" iron in a monument box in the center of the turn lane.  
 Witness 1 through 8 inclusive were gone.  
 found nothing to dispute the location of this corner.

**Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

left the 1" pipe in the monument box intact and accepted this as careful and faithful reestablishment of the position of the original corner. No additional monumentation was added.

1" P N58W 208.06' 16d nail and tag (Beebe) 39074 on S side  
 1" P N29E 77.39' 16d nail and tag (Beebe) 39074 on E side  
 1" P S39W 72.31' 16d nail and tag (Beebe) 39074 on NW side  
 1" fire hyd. Top center S55W 83.36'

Signed by [Signature] Date 8-10-2000  
 Surveyor's Michigan License No. 17634

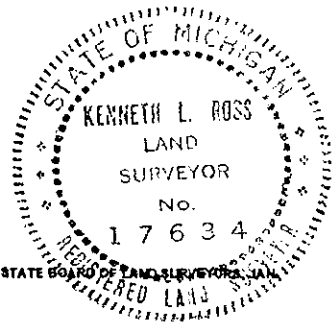

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN 1983

Approved by Peer Review Group on 8-10-2000  
 Kenneth L. Ross, County Representative [Signature]

28,  
 REVISED MAY 14, 1978  
 REVISED JAN. 1983  
 ADAPTED FOR WORD PROCESSING MARCH, 1983