

DEC 18 1995

COMMISSION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Mason _____ Located In: _____ Corner Code: # _____
(County)


1. Public Land Survey T 19N R 18W I-4
I _____ R _____
T _____ R _____
T _____ R _____

2. Property Controlling S _____ T _____ R _____
in Section S _____ T _____ R _____

3. Miscellaneous S _____ T _____ R _____
Property in Sec. S _____ T _____ R _____

4. Lot No. _____ Recorded Plat _____

5. Private Claims _____

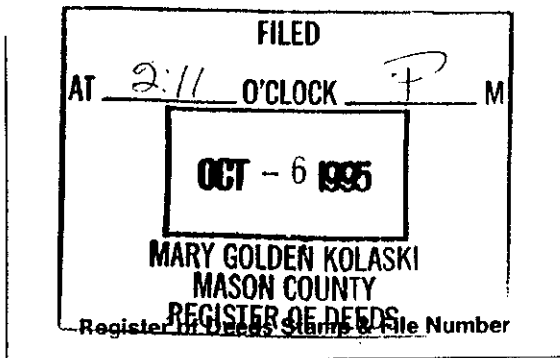

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	16	17	18	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Richard Hays in a field survey on September 19 95
do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

I-4 QUARTER CORNER COMMON TO SECTIONS 10 & 11
1838:G.L.O. Survey 1907:John A. Mitchell Survey
8" Beech S-14°-E 15 Links (1) Book 2, Page 59 Set 1" Iron
10" Beech N-20°-W 27 Links (2) No Witnesses.

1889:Highway Survey by MASON COUNTY ROAD COMMISSION
John A. Mitchell Power Pole NW 64.4' (3)
Book 1, Page 193 Telephone Pole SE 97.7' (4)
No Witnesses. Fence Corner SE 55.9' (5)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I-4 QUARTER CORNER COMMON TO SECTIONS 10 & 11
1995:Found 1" Iron. Found no other evidence to dispute this location.
Condition of Recorded Witnesses are as follows:
8" Beech S-14°-E 15 Links (1) GONE
10" Beech N-20°-W 27 Links (2) GONE
Power Pole Northwest 64.4' (3) GONE
Telephone Pole Southeast 97.7' (4) GONE
Fence Corner Southeast 55.9' (5) GONE

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I-4 QUARTER CORNER COMMON TO SECTIONS 10 & 11
1995:Replace 1" Iron with an 5/8" Re-Rod, 24" long with an Aluminum Cap stamped MASON COUNTY MONUMENT and is accepted as a careful and faithful perpetuation of the position of the Original Corner.
12" Poplar N-40°-W 93.72'
Power Pole S-33°-W 76.53'
10" Poplar S-66°-E 68.21'
Stop Sign N-63°-E 50.26'

RICHARD HAYS
LAND SURVEYOR
NO. 25847

Signed by Richard Hays
Surveyor's Michigan License No. 25847

Date: September 28, 1995
Peer Group Reviewed and Approved
Date: 9-28-95
Kenneth L. Ross
Mason County Surveyor

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983