


DOP

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Form with fields for MASON (County), Located In, Corner Code, and numbered sections 1-5 for Public Land Survey, Property Controlling, Miscellaneous, Lot No., and Private Claims.

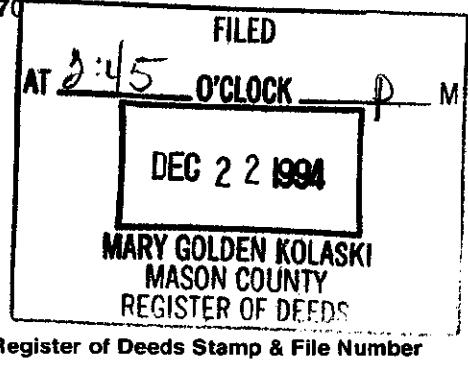

I, Sammy S. Barnett, In a field survey on October, 19 1994, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules...

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

J-7 1/4 corner for Section 14 & 23, T 19 N, R 15 W

1838, G.L.O., Sylvester Sibley Set Wood Post

#1 Pine 24" N 38° E 61k(3.96') #2 Beech 12" S 81° W 35(23.1')

1914, C.E. Mitchell, M.C.S. Found Stake & Witnesses

#3 Pine Stp. 25" S 09° E 381k(25.08') #8 Poplar (blue ring) South 39.00'

#4 Pine Stp. 18" N 54° W 781k(51.48') Book 2, Pages 191 & 192

1964, MCRC 2" Iron Pipe

#5 Fence North 35.5'

#6 Elm 12" SE 57.7'

#7 Tw. Maple SW 75.6'

1970, J. Borsfay MCRC Found 2" Iron Pipe

#9 Blazed Oak 10" NW 79.29'

#10 Blzd. Poplar 12" SW 51.47'

#11 Maple Clo. SW 75.87'

#12 Poplar 10" SE 57.66'

(OVER)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

J-7 1/4 corner for Section 14 & 23 T 19N, R 15 W

On November 2, 1994, I found 1/2" Re-Rod 4 foot North of center-line of Millerton Road, carefully removed Re-Rod to search for 2" Iron Pipe, found 2" Iron Pipe 4 foot below Road surface, left 2" Iron Pipe in ground. Found no conflicting evidence to disubuted corner location.

Condition of recorded witnesses is; #1 Gone #2 Gone #3 Gone #4 Gone #5 Gone #6 Gone #7 Found in good cond. #8 Gone #9 Found in good cond. #10 Gone #11 Same as 7 #12 Gone #13 & 14 #15 Found in good cond. #16 Same as 9 #17 Found in good cond. #18 Same as 9 #19 Same as 17 #20 Found in good cond.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

J-7 1/4 corner for Section 14 & 23, T 19 N, R 15 W


Replaced 1/2 " Re_Rod with 5/8" x 24" Re-Rod with a 2 1/2" aluminun cap, stamped: MASON COUNTY MONUMENT, 1 foot below the surface (gravel) of the Road, and is a careful and faithful reestablishment of the position of the original corner.

- (OBT #9) W. Oak 20" N 46° W 79.33' (60d spike in SW side of tree)
(OBT#15) W. Pine 9" S 38° W 65.88' (60d spike in SE side of tree)
(OBT#17) Cherry 5" N 02° E 39.60' (60d spike in NW side of tree)
W. Oak 5" S 28° E 66.52' (60d spike in NE side of tree)

Signed by Sammy S. Barnett
Surveyor's Michigan License No. 16923

Date 11-14-94

Peer Group Reviewed and Approved
Date: 12-7-94
Kenneth L. Ross
Mason County Surveyor

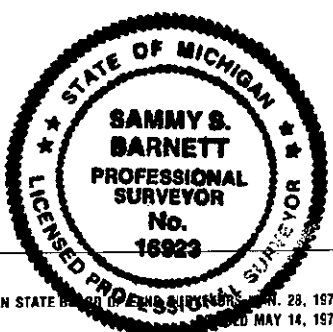

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983

(continued)

Ken Stephens, Plat of Ray-Paul

Used 2" Iron Pipe for corner

#13 Distance to NW cor. Sec. 23, 2638.99'

1974, Northwest Survey & Eng.

Used 2" Iron Pipe for Survey in Section 14, T19N, R15W

Job # 74076

#14 Distance to NW cor Section 23, 2638.54'

1981, Ken Ross, P.S.#

Found 2" Iron Pipe in C-L Road

#15 W. Pine 6" S 38° W 65.88'

#16 W. Oak 16" N 46° W 79.33'

#17 Cherry 5" N 02° E 39.60'

1989, Gordon Bonney

Found 1/2" Re-Rod

#18 W. Oak 16" N 46° W 79.33'

#19 W. Cherry 6" N 02° E 39.60'

#20 PS. cap RE_Rods 33.00" & 50.00' North