

SURVEY & REMONUMENTATION

MAR 16 1998

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

FILED
AT 3:00 O'CLOCK P M
JUN - 5 1997
MARY GOLDEN KOLASKI
MASON COUNTY
REGISTER OF DEEDS

For corners in SECTION
MASON (County)

Located In: Corner Code #

- 1. Public Land Survey T 19N R 15W I-13
- 2. Property Controlling In Section S T R
- 3. Miscellaneous Property in Sec. S T R

4. Lot No. _____ Recorded Plat _____
5. Private Claims _____

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Sammy S. Barnett, in a field survey on May 5 19 97, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

I-13 Southwest Corner, Section 35, on the township line

1838, G.L.O., John Mullette
Set Wood Post
#1 Maple 10" N 72° E 31 lks. (20.46')
#2 Maple 8" N 41° W 24 lks. (15.84')

1904, R. O. Towns, C.S.
Uses corner to set NW cor. of Sec. 2
T18N-R15W

1938, R. Lunde, C.S.
Monument not given, used cor. in Survey
in Sec. 34, T19N-R15W

1965, K. Stephens, C.S.
Replaced bent 1" iron pipe
with 1" iron pipe
#3 S. Maple 8" NW 65.48'
#4 W. Oak 4" SE 22.34'
#5 Power pole SW 39.25'

1971, R. A. Griffin, P.S.
Found 1" iron pipe, replaced
with a 5" sq. conc. monument
#6 W. Oak 5" N 37° W 114.32'
#7 Stone 3' x 3' N 15° W 79.37'
#8 W. Oak 4" SE 22.34'

#9 Power pole SW 39.25'
#10 Fine post 4" x 7"
N 45° W 46.83'

#11 Center of brass cap
in conc. monument
East 22.44'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

On September 20, 1994, I found a 5" square x 36" concrete monument with a 3" brass cap, monument is placed south of the center-line of Decker Road one foot below the road surface.


Condition of the recorded witnesses is:

- #1 Gone #2 Gone #3 Gone #4 Gone #5 Found in good cond. #6 Gone #7 Gone
- #8 Same as 4 #9 Same as 5 #10 Found in fair cond. #11 Found in good cond.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Accepted 5" x 36" concrete monument with brass cap (U.S.F.S.) as a substantial marker for the corner, and is accepted as a careful and faithful re-establishment of the position of the original corner.

- (OBT #11) Center of brass cap in concrete monument (NW cor. Sec. 2, T18N,R15W) East 22.44'
- Sugar Maple clump 10"-8" N 38° E 157.68' (60d spike in SE side of tree)
- Red Oak 5" N 23° W 157.20' (60d spike in stump, tree been cut)
- B. Oak 12" N 50° W 147.58' (60d spike in NE side of tree)
- Pine Post 4" sq. South 33.05'

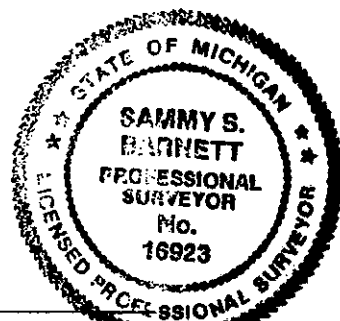

Signed by Sammy S. Barnett Date May 5, 1997

Surveyor's Michigan License No. 16923

Peer Group Reviewed and Approved
Date: Feb. 25, 1997
Kenneth L. Ross
Mason County Surveyor

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN. 1988
ADAPTED FOR WORD PROCESSING MARCH, 1988