

DEC 29 1993

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

SECTION

For corners in

MASON (County)

Located In:

Corner Code #

1. Public Land Survey

T 19N R 16W
T R
T R
T R
S T R
S T R
S T R

C-4

2. Property Controlling in Section

3. Miscellaneous Property in Sec.

4. Lot No. Recorded Plat

5. Private Claims

I, Kenneth L. Ross, in a field survey on August 25 19 98, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below.

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

C-4 1/4 Corner for Sections 7 and 8, T19N R16W.

1838, Sylvester Sibley, G.L.O.

Set Wood Post

- #1 Hemlock 30" S 59 E 5 lks. (3.30')
#2 Beech 8" N 45 W 7 lks. (4.62')

1899, R. O. Towns, Mason Co. Surveyor

Found original witness tree, still standing, #2 Beech, Monument not given, Towns show a distance of 39.56 chs. (2610.96') to the SW cor. (Book 2, Page 15)

1893, J. W. Griswald, Mason Co. Surveyor

Found post by old witness trees, replaced corner with new post. Shows distances of (39.31 chs.) 2594.46' to the SW cor. and (39.90 chs.) 2633.40' to NW cor. (Book 1, Page 264 & 265)

1989, Gordon Bonney, RLS #12016

Found Cabin Spike at Fence corners, replaced it with a 1/2" re-rod, with RLS cap (liber 3, pg. 4)
#3 Maple 4" N 25 W 40.54'
#4 Maple 4" N 87 W 31.31'
#5 Maple 20" S 18 W 20.92'

1995, Kenneth Ross, RLS #17634

Found and excepted Bonney's Re-Rod, for the corner. (file no. 95390a)

- #6 Maple 25" S 20 W 20.84' #8 Jack Pine 6" S 90 E 75.14'
#7 Maple 12" S 48 W 87.77' #9 Beech 14" N 53 W 142.36'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

C-4 1/4 Corner for Sections 7 and 8, T19N R16W.

On August 25, 1998, I found 1/2" Re-Rod with Bonney RLS yellow cap, at the intersection of old fence lines from all cardinal directions. I found no evidence to dispute this location for the 1/4 Corner.

Condition of record witnesses are as follows: #1 Gone #2 Gone #3 Gone #4 Gone

#5 Found in good condition #6 (Same as #5) #7 Found in good condition #8 Found in good condition

#9 Found in good condition

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

C-4 1/4 Corner for Sections 7 and 8, T19N R16W.

I replaced G. Bonney's 1/2" Re-Rod, in the exact location, with a 5/8" Re-Rod, 24" long, with an aluminum cap, stamped MASON COUNTY MONUMENT, also stamped to identify the corner, flush with the ground. This corner is accepted as a careful and faithful re-establishment of the position of the original corner.


- Ext. "BT" #5 Maple 25" S 20 W 20.82' (60d spike in NW side of tree)
Ext. "BT" #7 Maple 16" S 48 W 87.77' (60d spike in SE side of tree)
Ext. "BT" #8 Jack Pine 6" East 75.14' (60d spike in North side of tree)
Ext. "BT" #9 Beech 18" N 53 W 142.36' (60d spike in SW side of tree)

Signed by [Signature]

Date Sept. 8, 1998

Surveyor's Michigan License No. 17634

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 25, 1971
REVISED MAY 14, 1978
REVISED JAN. 1983
ADAPTED FOR WORD PROCESSING MARCH, 1983

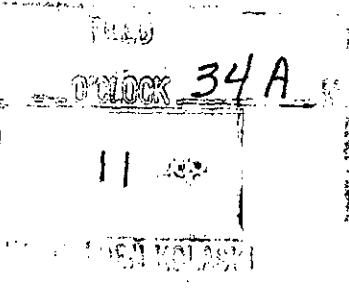

Register of Deeds Stamp & File Number

Grid with columns A-L and rows 1-12 containing numbers 6-36.

[Signature]