

DEC 29 1998

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

SECTION

For corners in

MASON

(County)

Located in:

Corner Code #

1. Public Land Survey

T 19N R 16W

G-3

T R

T R

T R

2. Property Controlling in Section


S T R

S T R

3. Miscellaneous Property in Sec.

S T R

S T R

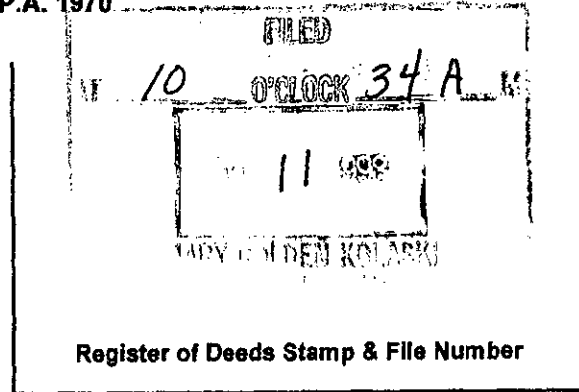

4. Lot No. Recorded Plat
5. Private Claims

Grid table with columns A-M and rows 1-13. Cell (3,4) contains a black dot.

I, Kenneth L. Ross, in a field survey on August 25 19 98, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below.

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
G-3 Section Corner for Sections 3, 4, 9 and 10, T19N-R16W

1838, Sylvester Sibley, G.L.O.
Set Wood post
#1 Hemlock 26" N 61 E 35 lks. (23.10')
#2 Hemlock 10" S 21 W 25 lks. (16.50')

1975, Kenneth Ross, RLS #17634
Found existing 3/4" Iron, 1.0 east of the east edge of paved road.
#6 Jack Pine 18" N 50 W 64.32' (wit. #3)
#7 Jack Pine 6" N 47 E 65.10' (wit. #4)
#8 Power-pole S 45 E 47.36' (wit. #5)

1972, Jay Borafay, Mason Co. Road Comm.
1" Iron on East side of black-top road, in gravel, 0.5 feet below surface.
#3 Jack Pine 15" NW 64.30'
#4 Jack Pine 5" NE 65.11'
#5 Power-Pole SE 47.44'
(Land corner record card E-13)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
G-3 Section Corner for Sections 3, 4, 9 and 10, T19N-R16W


On August 25, 1998, I found 3/4" Iron Rod inside an existing monument box, 10.7 feet East of the center-line of Custer Road. I found no evidence to dispute this location for the corner.

Condition of record witnesses are as follows: #1 Gone #2 Gone #3 Found in good condition #4 Gone
#5 Found in good condition #6 Found in good condition, same as 3 #7 Gone, same as 4
#8 Found in good condition, cut off, same as 5

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
G-3 Section Corner for Sections 3, 4, 9 and 10, T19N-R16W

I replaced 3/4" Iron Rod, in the exact location with a 5/8" Re-rod, with an aluminum cap, stamped MASON COUNTY MONUMENT, set inside the existing road monument box, this corner is accepted as a careful and faithful re-establishment of the position of the original corner.

Ext. "BT" #3 Jack Pine 24" N 50 W 64.40' (60d spike in SW side of tree)
Ext. "BT" #5 Power Pole S 45 E 47.48' (16p nail w/ shiner in NE side of pole)
New "BT" #9 Jack Pine 9" N 48 E 75.00' (60d spike in NW side of tree)
New "BT" #10 Guy Pole S 55 W 59.10' (60d spike in NW side of pole)

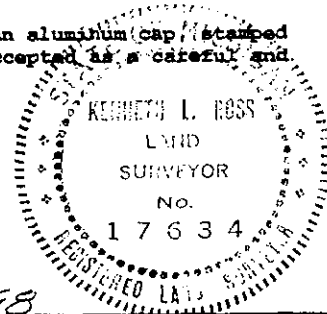

Signed by [Signature] Date Sept. 8, 1998

Surveyor's Michigan License No. 17634

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN. 1983
ADAPTED FOR WORD PROCESSING MARCH, 1993

Peer Group Reviewed and Approved
Date: 9-8-98
Kenneth L. Ross
Mason County Surveyor