

**SURVEY &
REMONUMENTATION**


MAY 07 1997

COMMISSION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Mason</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T 19N R 18W T 19N R 17W T ___ R ___ T ___ R ___	M-0-8 A-08 Same corner
2. Property Controlling in Section	S ___ T ___ R ___ S ___ T ___ R ___	_____ _____
3. Miscellaneous Property in Sec.	S ___ T ___ R ___ S ___ T ___ R ___	_____ _____

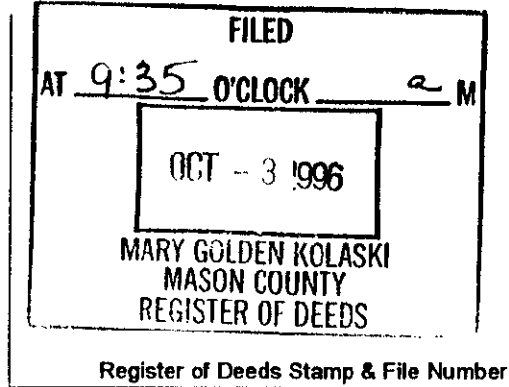

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Sammy S. Barnett, in a field survey on Sept, 1996 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L
1											
2	6		5		4		3		2		1
3											
4	7		8		9		10		11		12
5											
6	18		17		16		15		14		13
7											
8	19		20		21		22		23		24
9											
10	30		29		28		27		26		25
11											
12	31		32		33		34		35		36
13											

A. Description of original monument and accessories and/or subsequent restoration:

Corner common to section 24 T19N, R18W (Hamlin) & section 19, T19N, R17W (Victory) same corner 1838 Mullett & Brookfield G.L.O.

- | | |
|---------------------------------------------------------------------------------------|--------------------------------|
| Set post | #5 Tw. Maple 24" N50W 48.29' |
| #1 Hemlock 12" S45W 22 lks. (14.52") | #6 2' N. of E-W fence |
| #2 Hemlock 12" N24W 33 lks. (21.78') | Fd. R.R. spike 6' W. & 2.55' S |
| 1976 K. Ross Set 1" pipe 1/2 way & on line between NW & SW cor. 320' W. of gravel Rd. | with RLS cap 10064 (Kraft) |
| #3 W. Birch 6" S55E 51.59' | |
| #4 W. Birch 6" N80E 73.64' | |

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Corner common to section 24 T19N, R18W (Hamlin) & section 19, T19N, R17W (Victory); same corner
On Sept 12, I found 1" iron pipe. I found no evidence to dispute this location. The condition of the recorded witnesses are;


- # 1 Gone
- # 2 Gone
- # 3 W. Birch 6" S55E 51.59' spike in NE side
- # 4 W. Birch 6" N80E 73.64' spike in N. side
- # 5 Tw. Maple 24" N50W 48.29' spike in SW side
- # 6 Found R. R. spike

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner common to section 24 T19N, R18W (Hamlin) & section 19, T19N, R17W (Victory) same corner

I replaced the 1" pipe, in the exact location, with a Standard Mason County Monument and accepted this location as a careful and faithful reestablishment of the original corner

- # 3 W. Birch 6" S55E 51.59' spike in NE side
- # 4 W. Birch 6" N80E 73.64' spike in N side
- # 5 Tw. Maple 24" N50W 48.29' spike in SW side
- # 7 Maple 8" N65E 71.46' spike in NW side

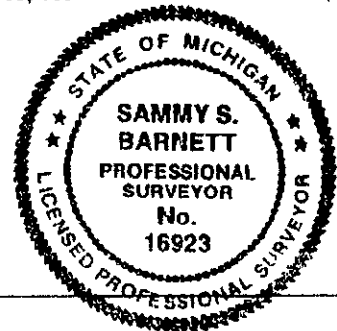

Signed by Sammy S. Barnett
Surveyor's Michigan License No. 16923

Date 9-28-96

Peer Group Reviewed and Approved
Date: 9-30-96
Kenneth L. Ross
Mason County Surveyor