

SURVEY & REMONUMENTATION


MAR 16 1998

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

SECTION

For corners in

<u>MASON</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>19N</u> R <u>17W</u>	E-13
	T _____ R _____	
	T _____ R _____	
	T _____ R _____	
2. Property Controlling in Section	S _____ T _____ R _____	<u>Sec. 2</u>
	S _____ T _____ R _____	
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	
	S _____ T _____ R _____	

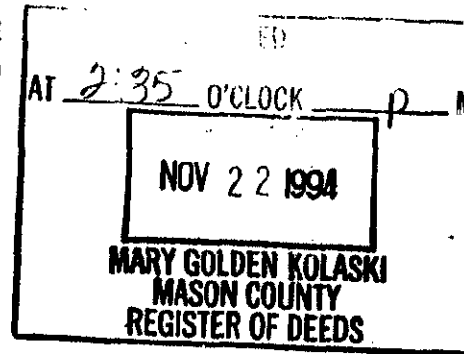

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Theodore H. Weinert, in a field survey on JULY, 1994, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

E-13 Section Corner, Secs. 32 & 33
G.L.O. Notes Set Post
1838 Sylvester Sibley
15" Beech N 62 E 57 lks
18" Beech N 52 W 50 lks
May, 1899, R. O. Towns Pd stake and pieces of brick (Book 2, Page 45 & Book 4, Page 2)
Stake for T18N, R17W, 46 lks East

Corner was reset by survey crew completing work for Consumer's Power Co. during the early 1960's

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

E-13 Section Corner, Secs. 32 & 33
Found T iron and pieces of brick 30.36' west of corner common to sections 4 & 5, T18N, R17W, old witnesses were in place but no record was found. Fit distances within reason to North, South, and West as recorded by R. O. Towns. This corner location is accepted as a careful and faithful perpetuation of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

E-13 Section Corner, Secs. 32 & 33
Replaced T iron with 5/8" X 36" rerod with standard 2 1/2" cap stamped "Mason County Remonumentation".
10" W. Pine S 34 E 59.56'
Stop Sign Post N 82 E 41.98'
6" Maple N 40 E 70.70'
12" Maple N 15 W 92.30'
Tel Box N 80 W 28.60'
Corner Common to Sections 4 & 5, T18N, R17W, East 30.36'



Signed by Theodore H. Weinert Date 10/4/94
Surveyor's Michigan License No. 19846

LIBER 3 PAGE 221

Peer Group Reviewed and Approved Date: 10-5-94 Kenneth L. Ross, Mason County Surveyor
FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971, REVISED MAY 14, 1975, REVISED JAN. 1983. Date: Feb 23 1995 Kenneth L. Ross, Mason County Surveyor