


MAR 16 1998

LAND CORNER RECORDATION CERTIFICATE

SECTION FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 20N N. S., R. 15W E. W.	A3
2. PROPERTY CONTROLLING IN SECTION	T. N. S., R. E. W.	Seg. 2
3. MISCELLANEOUS PROPERTY IN SECTION	T. N. S., R. E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

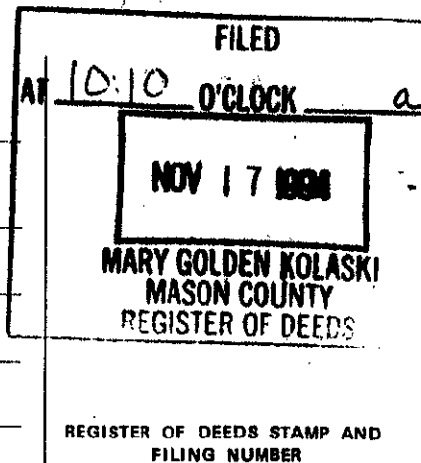

I, Patrick R. Leemon do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram—over) were, in a field survey on October 30 1994, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_ 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

- A. Description of original monument and accessories and/or subsequent restoration:
- Section corner common to sections 6 and 7 of T20N R15W and 1 and 12 of T20N R16W**
  - 1838 survey by Mullett & Brookfield**  
Set Wood Post  
#1 W.Pine 10 S76W 68 links  
#2 W.Pine 8 N37W 82 links
  - 1918 survey by C.E. Mitchell**  
Set concrete monument  
#3 Oak 7 S22E 83 links  
#4 Oak 10 S63W 25 links
  - 1972 survey by Robert A. Griffin #13584**  
Searched for and found the concrete monument by Mitchell. Replaced it w/ a 5" sq. by 60" long conc. monu. w/ 3" brass cap.  
#5 B.Oak 5 S67W 13.24 feet  
#6 W.Oak 5 N70W 54.20 feet  
#7 B.Oak 8 N52W 43.95 feet  
#8 B.Oak 9 N28W 39.26 feet

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:  
I found the 5" square by 60" long concrete monument w/ brass cap by Griffin 166 feet North of the centerline of the FR 8650 and E-W road and 117 feet west of the centerline of FR 8270 a N-S road. Witnesses 1 through 4 are gone. Witness 5 through 8 are in good condition. Liber 1 Page 78 by Griffin documents the history of this corner. I could find no conflicting information that would lead to another location. This monument is accepted as the best available evidence of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- Section corner common to sections 6 and 7 of T20N R15W and 1 and 12 of T20N R16W**
- Monu. The 5" square by 60" long concrete monu. with 3" brass disk ~~was~~ left in place
- Witnesses:  
J.Pine 10 N61E 63.15 feet  
R.Pine 9 S62E 53.09 feet  
B.Oak 11 S67W 13.23 feet (#5)  
W.Oak 8 N70W 54.21 feet (#6)  
B.Oak 11 N50W 44.00 feet (#7)  
B.Oak 15 N26W 39.29 feet (#8)



Peer Group Reviewed and Approved  
Date: 11-16-94  
Kenneth L. Ross  
Mason County Surveyor

SIGNED BY Patrick R. Leemon DATE October 30, 1994

SURVEYOR'S MICHIGAN REGISTRATION NO. 31595 (SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ CHIEF OF SURVEY PARTY DATE \_\_\_\_\_

APPROVED AND SIGNED BY \_\_\_\_\_ MICHIGAN REGISTERED LAND SURVEYOR DATE \_\_\_\_\_ (SEAL)

LIBER 3 PAGE 197

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_