

**SURVEY &
REMONUMENTATION**


OCT 29 1996

COMMISSION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

MASON (County)	Located In:	Corner Code #
1. Public Land Survey	T20N R15W	1-9
	T R	
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	

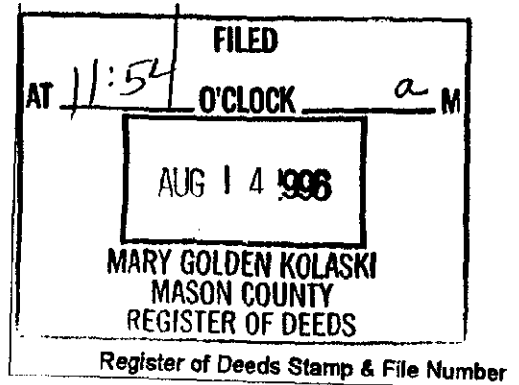

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Sammy S. Barnett, in a field survey on July 23, 1996, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1-9 Section Corner for Sections 23, 22, 27 and 26, T20N, R15W. **+ FROM OAK POST**

1838, John Brink, G.L.D.	1969, R.A. Griffin, USFS	1976, K. Ross, #17634
Set Wood post	Found USFS Post by Fern, Iron removed	Found dock spike in road surf.
#1 Beech 6" S50°W 181ks.(11.88')	by Road construction, set 16" dock spike N03°W	#6 B. Oak 12" S65°E 85.38'
#2 Beech 8" N34°W 041ks.(2.65')	341ks.(22.34') ^{ED} in line with trail road to the	#7 W. Oak 8" North 46.39'
	North.	#8 Cherry 5" South 28.95'
1937, H.L. Fern, Asst. Tech., USFS	#4 B. Oak scribe BT S65°E 85.38'	
Iron Pipe	#5 Wood Post USFS S37°E 23.45'	
#3 Oak post 8" S01° W 341ks.22.44'		

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

1-9 Section Corner for Sections 23, 22, 27 and 26, T20N, R15W.

On July 23, I found a 1/2" Re-rod and 16" dock spike inside a monument box, 3.0 feet, South of the center-line of Freesoil Road, I found no evidence to disputed this location for the corner.

Condition of recorded witnesses are;

- | | |
|----------------------------|----------------------------|
| #1 Gone | #5 Gone |
| #2 Gone | #6 Same as 4 |
| #3 Gone | #7 Gone |
| #4 Found in good condition | #8 Found in poor condition |

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

1-9 Section Corner for Section 22, 23, 26 and 27, T20N, R15W.


I replaced 1/2" Re-rod, in the exact location with a Standard Mason County Monument, placed inside an existing road monument box, and is accepted as a careful and faithful reestablishment of the position of the original corner.

(ext. BT #4) Black Oak 18" S 64° E 85.24'(dock spike in SW side of tree)
Maple 9" N 46° W 60.00'(60d spike in NE side of tree)
Red Oak 20" S 38° W 102.08'(60d spike in SE side of tree)
White Oak 11" N 61° E 89.50'(60d spike in NW side of tree)

Signed by Sammy S. Barnett

Date 8-17-96

Surveyor's Michigan License No. 16923

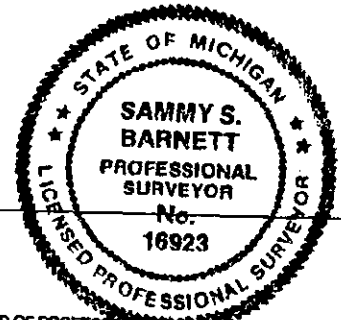

Peer Group Reviewed
and Approved
Date: 8-13-96
Kenneth L. Ross
Mason County Surveyor

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983
REVISED OCT., 1985

LIBER

4 PAGE

27