

FEB 08 2000


LAND CORNER RECORDATION CERTIFICATE

SECTION

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in MASON Located In: Corner Code #
(County)

- 1. Public Land Survey T 20N R 16W K-5
- T _____ R _____
- T _____ R _____
- T _____ R _____
- 2. Property Controlling S _____ T _____ R _____
- in Section S _____ T _____ R _____
- 3. Miscellaneous S _____ T _____ R _____
- Property in Sec. S _____ T _____ R _____

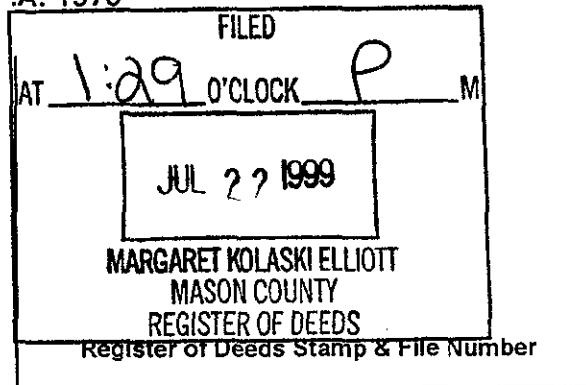

- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____

I, Kenneth L. Ross, in a field survey on May 22, 1999, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

K-5, Corner Common to Sections 11, 12, 13 and 14, T.20N., R.16W., GLO by John Brink, 1839, Set Section Post common To secs. 11,12,13 & 14
 (1) White Oak, 6", N11°W, 107 links
 (2) White Oak, 6", N85°E, 49 links
 Undated, Book 2, page 200 & 201 C.E. Mitchell, No comment on Cor.
 (3) White Oak, 13", N50°E, 116'
 (4) White Oak, 6", S34°E, 39'
 Distance South to K-6, 2682.24'
 Distance East to L-5, 2712'
 September, 1908. Book 2. Page 208 & 209 R.O. Towns, "Located old stake" No witnesses given
 Distance West to J-5, 2636.04'
 Distance South to K-6, 2686.20'
 1917, Book 2, page 520 C.E. Mitchell No comment on cor. Witnesses (3) and (4) given
 Distance North to K-4, 2758.80'
 Distance East to L-5. 2713.92'
 1920 C.E. Mitchell, 1922 DeYoung Same drawing "Standard cement cor."
 (5) White Oak, 13", N50E, 76.6'
 (6) White Oak, 6", S39°E, 25.7'
 Distance North to K-4, 2758.8'
 Distance West to J-5, 2650.4'
 July, 1956, Dwg. K-17 K.B. Stephens, "Ex. Cement Monument" No Witnesses Given
 Distance North to K-4, 2763.05'

1971, Dwg. K-62, R. Kraft No Comment on cor. No Wit. Given
 Distance North to K-4, 2762.53'
 Distance East to L-5, 2714.14'

May, 1978, Act 132, K.L. Ross, No Witnesses Given.
 Distance North to K-4, 2761.38'
 Distance East to L-5, 2712.28'

December, 1984, Act 132, K.L. Ross, "Found 4" Square Monument" No Wit.
 Distance West to J-5, 2631.81'
 Distance South to K-6, 2707.03'


May, 1988, Act 132, K.L. Ross, "Ex. Concrete Mon." No Wit.
 Distance West to J-5, 2631.41'
 Distance North to K-4, 2761.24'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

K-5, Corner Common to Sections 11, 12, 13 and 14, T.20N., R.16W.,
 Found 4" square Monument with 1" pipe in center, on Northeasterly Corner of a pine Plantation, about 600 feet east to a two track road.
 Witnesses (1) thru (6) have been destroyed. It is apparent, due to existing witness trees, that other surveyors have been in the area, but during The research of this corner I found no other recorded document to verify this.
 I could find no other evidence to dispute the location of this corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

K-5, Corner Common to Sections 11, 12, 13 and 14, T.20N., R.16W.,
 I left the existing 4" square Concrete Monument with 1" Pipe in the center, in place and accepted this corner as the best available evidence of the re-establishment of the Original Corner.
 (7) Existing 10" dock spike, SW side of 6" White Oak, N40°W, 10.78'
 (8) Existing 10d Nail, South side, 4" White Oak, S86°W, 12.28'
 (9) Existing 10d Nail, West side, 12" White Oak, S15°E, 41.51'
 (10) Existing 10d Nail, North side, 8" White Oak, S90°E, 9.90'
 (11) Old 8" Dia USFS Post, 1.0' North

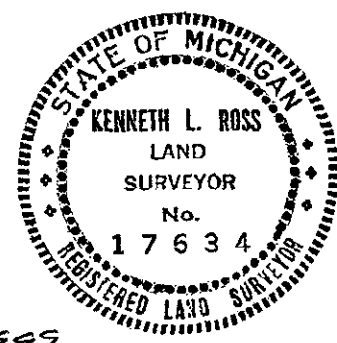

Signed by [Signature]
 Surveyor's Michigan License No. 17634

Date July 24, 1999

Peer Group Reviewed and Approved
 Date: 7-14-99