

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. PA 1970

For Corners In:
Midland Located In _____ Corner Code # _____
 (County)


- | | | | | | | |
|--------------------------------------|---|-------|-------|-------|-------|-------|
| 1. Public Land Survey | | T | 16N | R | 2E | B8 |
| | | T | _____ | R | _____ | _____ |
| 2. Property Controlling in Section | S | 19 | T | 16N | R | 2E |
| | S | _____ | T | _____ | R | _____ |
| 3. Miscellaneous Property in Section | S | _____ | T | _____ | R | _____ |
| | S | _____ | T | _____ | R | _____ |

4. Lot No: _____ Recorded Plat: _____

5. Private Claims: _____

I, Craig W. McVean, in a field survey on December 2, 2009 do hereby state that under requirements of PA 74, Michigan PA of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

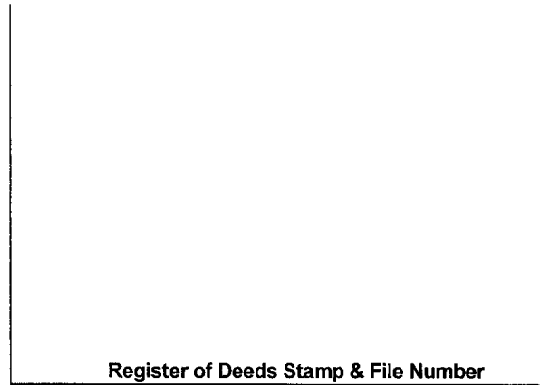

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8				19		20		21		22		23	
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

- B8 – Not set by GLO 5 – None
 - 1991 - Certificate of Survey Recorded in L. 4, P. 798, by Jerry L. Jones, PS #19838. No corner description given.



B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- B8 – Found 1" O.D. (3/4" I.D.) iron pipe with cap #19838 on NE'ly edge of cleared lane to West and South. 5 – CN 1/16 Corner Section 19 - Set a stamped 2" Aluminum cap on 5/8" x 5' long rebar per Standard BLM procedure. Corner in marshy area.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- B8 – 1" O.D. iron pipe with plastic cap #19838 5 – Stamped 2" Aluminum Cap on 5/8" x 5' rebar
- | | |
|---|--|
| N02°E 6.57' to set nail & tag in W side 7" R. Maple
S56°E 24.43' to set nail & tag in SW side 10" Ash
S37°W 3.67' to set nail & tag in W side 6" R. Maple
N81°W 27.35' to set nail & tag in N side 9" R. Maple
Set Blue Carsonite Post with location tag 1' NW. | N41°E 30.36' to set nail in NW side 4" Oak
S47°E 11.05' to set nail & tag in NE side 36" R. Maple
S53°W 46.00' to set nail & tag in SE side twin 17" Oak
S84°W 84.01' to set nail & tag in N side 36" Oak
Set Blue Carsonite Post with location tag 1' Southwest |
|---|--|

Signed by: Craig W. McVean Date: 1/13/2010
 Surveyor's Michigan License No.: 39088