


MAY 28 1997

COMMISSION

RECEIVED FOR RECORD

96 DEC 13 PM 3:21

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A., 1970



For corners in

Monroe  
(County)

Located In:

Corner Code #

Whiteford Twp.

1. Public Land Survey

T 8S R 6E

1-12

T \_\_\_\_\_ R \_\_\_\_\_

T \_\_\_\_\_ R \_\_\_\_\_

T \_\_\_\_\_ R \_\_\_\_\_

2. Property Controlling  
in Section

S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_

S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_

3. Miscellaneous  
Property in Sec.

S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_

S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

5. Private Claims \_\_\_\_\_

I, Bruce Antcliff, in a field survey on August 19 96 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and / or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

Monroe County Road Commission Corner

1	A	B	C	D	E	F	G	H	I	J	K	L
2	6		5		4		3		2		1	
3												
4	7		8		9		10		11		12	
5												
6	18		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												

A. Description of original monument and accessories and/or subsequent restoration:

Quarter corner common to sections 34 & 35 T8S,R6E, Whiteford township / Jeffs & Section Road, tarby over stone  
-1820 GLO Surveyor Wampler set wood post; Black Oak, 21", S41W, 37 links; White Oak, 10", N9W, 25 links  
1956 MDOT Project #58034, sheet 9, witnesses to E1/4 corner (monument not described), N10E, 97.39FT., 22" Elm;  
S57W, 39.68FT., Tele.Pole; N51W, 55.88FT., 22" Elm.  
Aug. 1973 Glenn Richard, Recorded Survey L655, P916; LCRC L1,P375, found iron rod 8" below road surface, set R.R. Spike at surface  
May 1977 Fred Berning, Boundary survey, found R.R. Spike  
Dec. 1977 Fred Berning, Boundary survey, found Iron  
Sept. 1978 M.R. Fleck, Boundary survey, found R.R. Spike  
Oct. 1978 J.A. Fish, LCRC L2,P282, found R.R. Spike,

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

October 1995, Excavated 3'x3'x30" deep hole. Found R.R. Spike over Iron rod. No other evidence was found.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


Set 1"x36" iron pipe with brass remonumentation cap inside monument box to replace R.R.Spike and is accepted as the best available evidence of the position of the original corner.

Witnesses:

N23E, 69.77FT., Mag nail/MCRC tag in south face of 10" Maple  
S65E, 67.43FT., nail/shiner in NE face of Utility pole  
S25E, 34.23FT., 16d nail in N face of 12" twin Hickory  
S40W, 146.40FT., SE corner of block foundation of one story frame house  
S67W, 46.90FT., Duplex nail/shiner in N. face of Utility pole

RATIFIED BY PEER GROUP  
PA 345 OF 1990  
MONROE COUNTY, MICHIGAN

date: 9/24/1996  
County Rep.: [Signature]

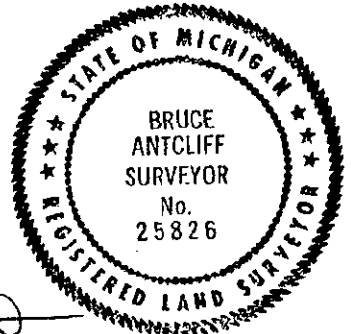

Signed by Bruce Antcliff

Date 11-13-96

Surveyor's Michigan License No. 25826