

DEC 19 2000 MONTCALM COUNTY REMONUMENTATION PROGRAM

LAND CORNER RECORDATION CERTIFICATE

SECTION

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in


Montcalm
(County)

Located In:

Bushnell Township

Corner Code #

- | | | | | | | | |
|------------------------------------|---|----|---|---|----|---|------|
| 1. Public Land Survey Sec. 5, 6 | T | 09 | N | R | 06 | W | C-01 |
| | T | | R | | | | |
| | T | | R | | | | |
| | T | | R | | | | |
| 2. Property Controlling in Section | S | | T | | R | | |
| | S | | T | | R | | |
| 3. Miscellaneous Property in Sec. | S | | T | | R | | |
| | S | | T | | R | | |

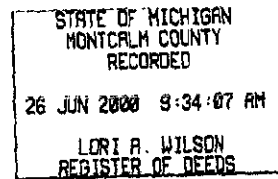

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, William G. Tingley, in a field survey on April 19, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6	5	4	3	2	1						
3													
4		7	8	9	10	11	12						
5													
6		18	17	16	15	14	13						
7													
8		19	20	21	22	23	24						
9													
10		30	29	28	27	26	25						
11													
12		31	32	33	34	35	36						
13													

A. Description of original monument and accessories and/or subsequent restoration:

1. November 15, 1837, Noah Brookfield, Deputy Surveyor, GLO notes Page 75 North between Sections 5 and 6.

North line 30 links (19.80 feet) East of post. Set post corner of Sections 5 and 6.
W. ash 12" S77°W 23 links (15.18 feet)
Beech 8" S63°E 19 links (12.54 feet)

2. 1969, George Stevenson card file #11, at Tingley and Associates office

Found 3/4" iron bar
Axle shaft Ev. Twp Cor. W 19.10 feet
SW cor. garage NNW 108.84 feet
SW cor. house NE 60.75 feet
NW cor. house SW 42.70 feet

3. August 11, 1976, George M. Stevenson, JR. # 13600, LCRC Liber 001 Page 352

Found 3/4" iron bar
SW cor. house N45°E 61.00 feet
Tele. pole S45°E 49.00 feet
Axle shaft Ev. Twp. Cor. West 19.10 feet
NW cor. house SE 187.70 feet

ACCEPTED BY THE MONTCALM COUNTY SURVEY PEER GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 345 OF 1990 AT A MEETING HELD 6/14/00

WGT.
William Tingley, PS, Chairman



- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
Searched the apparent location of the corner. Found a 3/4" x 3.10 feet iron shaft 6" below the surface of the road. Under the iron shaft is a 1/4" iron pipe. Excavated a 4.00 feet x 5.00 feet x 6.00 feet deep and did not reach the end of the pipe.

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
Set the remonumentation pipe over the 1/4" pipe.

Set N/T W/S 13" maple N03°E 41.63 feet
T/C phone riser N26°W 37.90 feet
SW cor. house #1045 N44°E 60.73 feet
Set N/T NW/S 23" walnut N57°E 61.58 feet
T10N-R06W C-13 West 19.16 feet



LIBER 4 PAGE 244

This corner is accepted as the best available evidence of the position of the original corner.

Bearings given are magnetic. Standard remonumentation pipe consists of a Berntsen stainless steel 2 3/8" x 30" pipe with a brass cap stamped "MONTCALM COUNTY REMONUMENTATION, P.S. # 30104"

Signed by William G. Tingley Date 6/14/00
Surveyor's Michigan License No. 30104