

**SURVEY & REMONUMENTATION**

APR 28 1999

**MONTCALM COUNTY REMONUMENTATION PROGRAM  
LAND CORNER RECORDATION CERTIFICATE**

**SECTION**

Filing Requirement of Act 74, Mich. P.A. 1970

STATE OF MICHIGAN  
MONTCALM COUNTY  
RECORDED

23 APR 1999 11:03:42 AM

LORI A. WILSON  
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

For corners in Montcalm (County)	Located In: Pine Township	Corner Code #
1. Public Land Survey	Sec T 11N R 8W	C-4, 1/4 Corner
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

I, William Tingley a field survey on February 15, 1996, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

- A. Description of original monument and accessories and/or subsequent restoration:  
 1839, Noah Brookfield, Deputy Surveyor, GLO Notes  
 North between Sections 7 and 8; at 40 chains, set Quarter Section Post  
 Black Ash 20" S52°E 11 links  
 Beech 6" N68°W 27 links  
 1891, E. Jones, County Surveyor, Old Field Book 11-8, Page 11  
 Found all government corners and took post established by Caukin (County Surveyor) at Center of Section as correct  
 1908, J. Daoust, County Surveyor, Field Book, page 20-21  
 At East 1/4 drove gas pipe and set stone around same.  
 Elm 12" S11-1/2°W 126-1/2 links  
 Hickory 6" N63-3/4°E 99-1/4 links  
 1908, J. Daoust, County Surveyor, Liber 3, Page 314, Record of Minutes of Survey  
 Same bearing trees.  
 R.D. McNutt, County Surveyor, Index Card File Records  
 The above bearing trees and:  
 Beech 10" S34-1/2°W 62 links  
 1958, Montcalm County Road Commission, on old card file records  
 Elm 30" Southeast 40.2 feet  
 Road Name Post Southwest 45.35 feet  
 Hickory 20" Northeast 65.20 feet (Daoust bearing tree?)  
 Found Iron Shaft, raised with steel shaft 3-26-58

ACCEPTED BY THE MONTCALM COUNTY SURVEY PEER GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 345 OF 1990 AT A MEETING HELD 4/16/98

WGT  
William Tingley, PS, Chairman

Continued on back.....


- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:  
 Found Railroad Spike. Reset Corner from old center and old 1/4 1/4 Corner to West per J. Daoust 1908 Survey.  
 Center to 1/4 1/4 Post 1287.82 (1908-1287.0)  
 1/4 1/4 Post to East 1/4 Post 1287.82 (1908 - 1287.0)  
 Found 1-1/2" Gas Pipe 2.7 feet deep at North 1/4 1/4 post of Southeast 1/4 and also found Daoust Bearing Tree (White Ash 5" (now 26") N07-1/2°W 50 links
- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:  
 Set Remonumentation Monument  
 Railroad Spike West 5.84 feet  
 Found Nail and Tag East Side 6" Oak N15°W 23.92 feet  
 Set Nail and Tag Northwest Side 8" Oak N40°E 38.93 feet  
 Set Nail and Tag West Side Wood Post S40°E 45.08 feet

Liber 4 Page 86 395

This corner is accepted as a careful and faithful perpetuation of the position of the original corner.

Signed by William Tingley Date 4/11 1998

Surveyor's Michigan License No. 30104

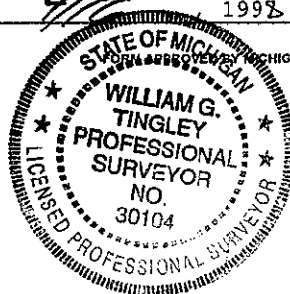

MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971  
 REVISED MAY 14, 1976  
 REVISED JAN., 1983  
 ADAPTED FOR WORD PROCESSING MARCH, 1993

October 1992, W. Tingley #30104, from corner sheet for Job 92476

From All-Points Survey Liber 577, Page 10, found railroad spike and Bearing Trees

Set P.K. East Side Power Pole	S20°W	122.60 feet
Set P.K. Nail Northeast Side Wood Fence Post	S45°E	46.05 feet
Set P.K. Nail Top of Wood Fence Post	North	25.0 feet
Center Line Street Sign	S45°W	42.3 feet
Found All-Points P.K. in Power Pole and		
Set Nail & Tag East Side 3" Oak	North	23.32 feet
Set Nail & Tag Northwest Side Triple 4" Elm	N50°E	58.16 feet
Street and Stop Sign	Southeast	46.60 feet

SURVEY &  
PLANNING

APR 28 1993

SECTION