

DEC 19 2000

MONTCALM COUNTY REMONUMENTATION PROGRAM  
LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

SECTION

For corners in

Montcalm  
(County)


Located In:

Maple Valley Township

Corner Code #

L-13

- 1. Public Land Survey Sec. 36 T 11 NR 09 W  
T R  
T R  
T R
- 2. Property Controlling S T R  
in Section S T R
- 3. Miscellaneous S T R  
Property in Sec. S T R

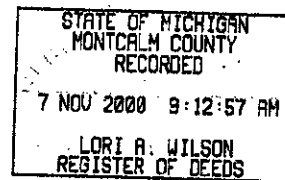

Register of Deeds Stamp & File Number

- 4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_
- 5. Private Claims \_\_\_\_\_

I, William G. Tingley, in a field survey on February 04, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- 1. December 11, 1836, Noah Brookfield, Deputy Surveyor, GLO notes  
West on south side Section 36. 40.00 chains, set quarter post  
Maple 10" N15°W 7 links (4.62 feet)  
Maple 8" N69°E 61links (40.26 feet)
- 2. April 09, 1979, Paul E. VanKooten, # 8618, LCRC Liber 001 Page 482  
Set railroad spike on centerline of road to north and north line of Section 01, T10N-R-09W extended  
PK in S. Side PP WNW 147.71 feet  
PK in NW side PP NE 70.10 feet  
Spike SE side elm 4" ESE 72.49 feet
- 3. April 09, 1979, Paul E. Van Kooten, # 8618 Certificate of Survey Liber 519 Page 471  
Railroad spike, Witnesses the same as LCRC in # 2 above.
- 4. 1989, William R. Byl, # 23502, Survey notes for Survey 22-Mile Road for MI Bell Right-of-Way field notes  
Nothing found. Measured distance to K-13 as 2640.60 ± feet.
- 5. June 19, 1997, William G. Tingley, # 30104, Certificate of Survey # 97263-001  
Found 1/2" rerod  
Fnd PK NW/S PP N40°E 70.20 feet  
Fnd PK SW/S PP N75°W 147.70 feet  
Set N/T SW/S elm 12" S75°W 72.40 feet

ACCEPTED BY THE MONTCALM COUNTY SURVEY PEER GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 345 OF 1990 AT A MEETING HELD 10/11/00

WGT  
William Tingley, PS, Chairman

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Searched apparent location of the corner. Found 1/2" rerod 1.0 feet below surface of gravel road and 1.0 feet north of centerline of road and in center of north/south road.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- Set standard remonumentation pipe over 1/2" rerod
- Fnd N/T # 30104 SW/S elm 12" S58°E 72.20 feet
- Fnd PK NW/S PP N48°E 70.10 feet
- Set N/T # 30104 NE/S PP N70°W 147.80 feet
- East side Stop sign N13°W 52.65 feet
- East leg Arrow sign S13°W 18.80 feet
- T10N-R09W K-01 East 473.85 feet

This corner is accepted as the best available evidence of the position of the original corner.

Bearings given are magnetic. Standard remonumentation pipe consists of a Berntsen stainless steel 2 3/8" x 30" pipe with a brass cap stamped "MONTCALM COUNTY REMONUMENTATION, P.S. # 30104"



Signed by William G. Tingley Date 10/11/00  
Surveyor's Michigan License No. 30104

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971  
REVISED MAY 14, 1975  
REVISED JAN., 1983  
ADAPTED FOR WORD PROCESSING MARCH, 1983

