

MONTCALM COUNTY REMONUMENTATION PROGRAM
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

DEC 19 2000

SECTION

For corners in Montcalm Located In: _____ Corner Code # _____
 (County) Township


1. Public Land Survey Sec. 31 T 11 N R 10 W B-13
 T _____ R _____
 T _____ R _____
 T _____ R _____

2. Property Controlling S _____ T _____ R _____
 in Section S _____ T _____ R _____

3. Miscellaneous S _____ T _____ R _____
 Property in Sec. S _____ T _____ R _____

4. Lot No. _____ Recorded Plat _____

5. Private Claims _____

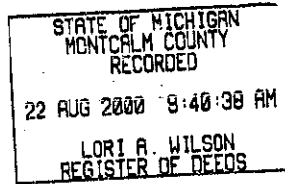

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, William G. Tingley, in a field survey on May 10, 2000 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1. **December 12, 1836, Noah Brookfield, GLO notes, West on south side of section 31**
 Set quarter section post at 40.00 chains
 Maple 10" N62°W 30 links (19.80 feet)
 Birch 10" N63°E 23 links (15.18 feet)



LIBER 4 PAGE 257

2. **April 14, 1905, John F. Daoust, County Surveyor, Record of Minutes of Survey, Section 31 T11N R10W**
 Re-established at intersection of first correction line and N & S qr. Line 1.28 chains (84.48 feet) West of sec cor 6-10-10.
 Drove gas pipe 1 1/2" x 40"
 Pine Stump S80°E 8 links (5.28 feet)

3. **January 13, 1966, Harlan J. Page, Survey Chief, Michigan State Highway Department, Gov't. Monument Witness Record**
 Found 1 1/2" iron pipe 1.5' below road surface, raised to surface with 3/4" iron pipe
 T. Pole S16°W 45.62 feet
 Cor. fence post N03°E 31.44 feet
 Fence post S58°W 38.66 feet

4. **June 6, 1980, Paul E. Van Kooten, # 8618, LCRC Liber 001 Page 506**
 Found 1" iron
 Spk W/S 18" Basswood N-NE 44.24 feet
 SW cor hse fndn NW 204.62 feet
 PK NE/S cor fence po SE 40.41 feet
 Cent. Mon. box (N1/4 Sec. 6 T10N R10W)
 East 84.75 feet

5. **May 12, 1999, Kirk Breitels # 30077, Kent County Remonumentation LCRC # 11246**
 S 1/4 corner Sec. 31 T11N-R10W 1" iron pipe West 84.69 feet



B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
 Searched the apparent location of the corner. Found 1" iron next to 1 1/4" pipe inside 3" pipe.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
 Set remonumentation pipe in monument box in place of 1" iron and pipes.

Fnd Kent Co. mon box S83°E 84.75 feet
 Fnd SW cor hse. fndn N33°W 204.62 feet
 NW cor 1.5' x 3.05' util. Box S40°E 58.05 feet
 Set N/T E/S 12" Elm N39°W 77.15 feet
 CL of E-W rd North 1.00 feet
 Fnd K.C N/T Basswood N29°E 43.70 feet

ACCEPTED BY THE MONTCALM COUNTY SURVEY PEER GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 345 OF 1990 AT A MEETING HELD 8/09/00

WST
 William Tingley, P.S., Chairman

This corner is accepted as the best available evidence of the position of the original corner.

Bearings given are magnetic. Standard remonumentation pipe consists of a Berntsen stainless steel 2 3/8" x 30" pipe with a brass cap stamped "MONTCALM COUNTY REMONUMENTATION, P.S. # 30104"

Signed by William G. Tingley Date 8/09/00
 Surveyor's Michigan License No. 30104