


DEC 19 2000

MONTCALM COUNTY REMONUMENTATION PROGRAM
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

SECTION

For corners in Montcalm (County) Located In: Township Corner Code #
1. Public Land Survey Sec. 32, 33 T 11N R 10 W E-13
2. Property Controlling in Section S T R
3. Miscellaneous Property in Sec. S T R
4. Lot No. Recorded Plat
5. Private Claims

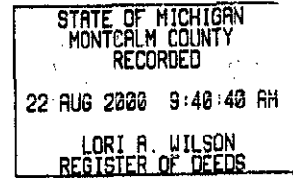

Register of Deeds Stamp & File Number

I, William G. Tingley, in a field survey on May 10, 2000 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

Grid table with columns A-L and rows 1-13. Values range from 1 to 36.

A. Description of original monument and accessories and/or subsequent restoration:

1. December 12, 1836, Noah Brookfield, Deputy Surveyor, GLO notes, West on south side of section 33.

Set post corner of Sections 32, 33 at 80.00 chains
Beech 9" N38°E 37 links (24.42 feet)
W. Ash 10" N49 1/2°W 54 links (35.64 feet)

2. April 27, 1876, Stone and Seeley Plat Liber 001 Page 027

Shows the intersection of the section/town line and north/south section line at the centerline of Eighth and Pine Streets

3. September 26, 1974, Douglas W. Bonnema, # 12579, LCRC Liber 001 Page 197

Found 3" diameter pipe
P.K. in P.P. WNW 75.96 feet
NE cor hse fndn SW 70.83 feet
SE cor hse fndn NW 127.78 feet
Iron West 33.00 feet



LIBER 4 PAGE 260

4. September 29, 1977, Paul E. Van Kooten, # 8618, LCRC Liber 001 Page 414

Found 4" iron
PK N/S P.P. West 76.00 feet
PK W/S P.P. NE 76.25 feet
PK W/S T. Pole S-SE 45.15 feet
Spike SW/S 36" Oak NW 78.74 feet
Spike SW/S 16" Elm SE 36.15 feet

5. May 28, 1985, Glen S. Hackbardt, # 25844, Certificate of Survey Liber 585 Page 1043

Found 4" Pipe
NW cor hse (brk) S45°E 101.80 feet
C.P. N85°W 77.90 feet
NE cor Conc. Base S40°W 85.60 feet

6. May 18, 2000, Kirk Breitels # 30077, Kent County Remonumentation LCRC # 11807

Measured from T10N-R10W D-01 to T11N-R10W E-13 west 220.20 feet

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Searched apparent location of the corner. Found 4" pipe 12" long with a 3" pipe coming off the side and a 1/4" rod in the middle of the 4" pipe. The pipe was setting on top of an 8" x 16" rough cut masonry block.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set remonumentation pipe with the 8" x 16" block to the east of it.

Fnd PK N/S P.P. N72°W 76.00 feet
Fnd bent Iron West 33.00 feet
Fnd NE cor hse fndn S57°W 70.95 feet
Fnd PK NE/S P.P. S39°E 48.94 feet
S/S stop sign post N63°E 41.35 feet
N/T E/S 52" Oak N20°W 78.30 feet
T10N-R10W D-01 East 220.20 feet

ACCEPTED BY THE MONTCALM COUNTY SURVEY PEER GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 345 OF 1990 AT A MEETING HELD 8/29/00.



William Tingley, PS, Chairman

This corner is accepted as the best available evidence of the position of the original corner.

Bearings given are magnetic. Standard remonumentation pipe consists of a Berntsen stainless steel 2 3/8" x 30" pipe with a brass cap stamped "MONTCALM COUNTY REMONUMENTATION, P.S. # 30104"

Signed by William Tingley Date 8/09/00
Surveyor's Michigan License No. 30104