

MONTCALM COUNTY REMONUMENTATION PROGRAM

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

SECTION

For corners in


Montcalm  
# \_\_\_\_\_  
(County)

Located In:

Corner Code

Pierson Township

1. Public Land Survey	Sec 1,2 T 11N R 10W	K-01
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

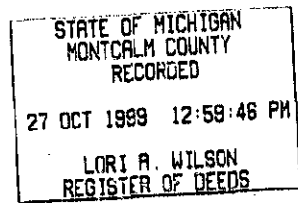

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

5. Private Claims \_\_\_\_\_

I, William G. Tingley a field surveyor on July, 14, 1999, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1837, September 30<sup>th</sup>, Abner E, Van Nifs, Deputy Surveyor, GLO Notes, North between Section 1 and 2

80.00 chains Intersected North boundary line 20 links East of post. Corner to sections 35 & 36, set post to sections 1 & 2.

Beech 12" N61°E 10 links

Beech 18" S17°W 18 links

1887, July 2<sup>nd</sup>, H.M. Caukin, County Surveyor, Found Sec. Cor. 35 & 36 South boundary 20 links (13.2') West of bottom of wooden stake, Cor. of 1 & 2 as reset by me 1869.

No Date, Note Card,

Sec Cor 1-2 N Bdry

Beech 12" N61°E 10 links

Beech 18" S17°W 18 links

Jan. 1869, New corner reestablished 20 links East of Corner 35 & 36

Pine 24" S40°W 04 links

1984, Feb. 14<sup>th</sup>, Glen S. Hackbardt, #25844, L.C.R.C. Liber 2 Page 51,

Set 1/2" rebar 13.2' East of K-13 Reynolds. This point falls on line ext. from K-2 through. Iron near East

1/8 post for NE 1/4 Sec. 2

Cen. St Sign N40°W 52.5 feet

Cen. Stop Sign S80°W 66.6 feet

Cen. Stop Sign S60°W 45.7 feet

Cen. Stop Sign N70°E 59.7 feet

Other iron NW 8.8 feet

Other iron W 13.2 feet

ACCEPTED BY THE MONTCALM COUNTY SURVEYOR PEER GROUP AS THE OFFICIAL CORNER FOR MICHIGAN PUBLIC ACT 345 OF 1990 AT A MEETING HELD 7-28-99

WGT  
William Tingley, PS, Chairman

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 1/2" rebar with unreadable yellow broken cap.

Found North leg Stop Sign N53°E 43.30 feet

Found Center Street Sign N30°W 52.40 feet

Found Center Stop Sign S83°W 62.40 feet

Found K-13 T12N-R10W Monument West 13.20 feet

Found Other Iron N50°W 8.70 feet

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set Standard Remonumentation Monument over 1/2" rebar & cap.

Found North leg Stop Sign N53°E 43.30 feet

Found Center Street Sign N30°W 52.40 feet

Found Center Stop Sign S83°W 62.40 feet

Found K-13 T12N-R10W Monument West 13.20 feet

Found Other Iron N50°W 8.70 feet

Set Nail and Tag NE side

Power Pole N55°W 74.20 feet

This corner is a careful and faithful reestablishment of the position of the original corner.



Signed by William Tingley

Date 7-28-99, 1999

Surveyor's Michigan License No. 30104

