

JAN 20 2000

SECTION

LAND CORNER RECORDATION

CERTIFICATE


Filing Requirement of Act 74, Mich. P.A. 1970

For corners in  
Montcalm  
 (County)

Located In:  
Home Township

Corner Code #

1. Public Land Survey	Sec	T <u>12N</u> R <u>06W</u>	<u>G-8</u>
		T _____ R _____	_____
		T _____ R _____	_____
		T _____ R _____	_____
2. Property Controlling in Section	S _____	T _____ R _____	_____
	S _____	T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____	T _____ R _____	_____
	S _____	T _____ R _____	_____

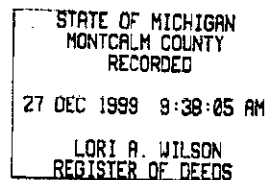

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

5. Private Claims \_\_\_\_\_

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, William Tingley a field survey on June 9, 1999 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- Oct 31, 1837, John Milroy, Deputy Surveyor, GLO Notes Set quarter section post  
 Pine 14" N43°W 30 Links  
 Pine 36" N37°E 16 Links
- 1906, October, John F. Daoust, County Surveyor, Minutes of Survey of Section 21, T12N R6W  
 Found stake bottom agreeing with remains of BT, Set plow point with stone and crockery around it Took NBT Oak 6"
- 1906, John F. Daoust, County Surveyor, Index card (#84) ¼ po. 21-22 Set plow Point  
 Pine 14" N43°W 31 Links  
 Pine 36" N55°E 16 Links  
 Oak 6" N65 ¼°E 53 ¼ Links  
 Oak 8" S56°E 93 Links
- 1972, July 17, Donald R. Verba, #13603, Found 1" iron bar 20" deep, raised with 5/8" Rebar at Centerline of Neff Road and Fence Line. Liber 1 page 37  
 Set RLS tag North side Power Pole Az. 87° 87.06 feet  
 Set RLS tag South side Power Pole Az. 230° 43.70 feet  
 Set Rls tag North side 36" Oak Az. 281° 114.28 feet
- 1987, July 22, W. Tingley, #30104, Survey #87630.  
 West ¼ Corner Found ¼" iron bar Section 22, T12N R6W
- 1994, October 11, W. Tingley, #30104, Survey #9447  
 East ¼ Corner Section 21 T12N R6W  
 Power Pole N87°E 87.06 feet  
 Power Pole S50°E 43.70 feet  
 36" Oak N79°W 114.28 feet

ACCEPTED BY THE MONTCALM COUNTY SURVEYORS GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 345 OF 1990 AT A MEETING HELD 11/29/99

WGT  
 William Tingley, PS, Chairman



B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- Found ¼" Iron rod 18" long 6" blow surface of pavement. Below ¼" Iron found Chromed Iron 1" diameter at top and ½" diameter at the bottom.  
 Nail and Tag #13603 in Power Pole S50°W 43.70 feet  
 Found wooded fence row to the west  
 Located iron in centerline Neff Road

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- Set Remonumentation in place of irons.  
 Nail and Tag #13603 in Power Pole S50°W 43.70 feet  
 NE corner post Michcon fence N57°E 40.70 feet  
 SE corner post Michcon fence S44°E 44.70 feet  
 East side Speed Limit Sign Post West 19.44 feet

This corner is accepted as the best available evidence of the position of the original corner.

Signed by William Tingley Date 22 Dec, 1999

Surveyor's Michigan License No. 30104

