

**MONTCALM COUNTY REMONUMENTATION PROGRAM
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970**

DEC 19 2000

SECTION

For corners in
Montcalm
(County)


Located In:
Winfield Township

Corner Code #
I-10

1. Public Land Survey Sec. 26,27 T 12 N R 09 W	T	R	<u>I-10</u>
	T	R	
	T	R	
2. Property Controlling in Section	S	T	R
	S	T	R
3. Miscellaneous Property in Sec.	S	T	R
	S	T	R

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

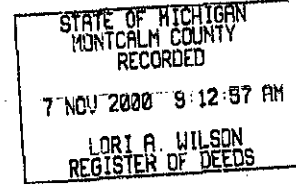

Register of Deeds Stamp & File Number

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6	5	4	3	2	1						
3													
4		7	8	9	10	11	12						
5													
6		18	17	16	15	14	13						
7													
8		19	20	21	22	23	24						
9													
10		30	29	28	27	26	25						
11													
12		31	32	33	34	35	36						
13													

I, William G. Tingley, in a field survey on July 20, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

- A. Description of original monument and accessories and/or subsequent restoration:
- April 4, 1838, John Hodgson, Deputy Surveyor, GLO notes, North between sections 26 and 27
Set quarter section post
Beech 16" S30°W 20 links (13.20 feet)
Beech 6" N38½°W 13 links (8.58 feet)
 - No date, R.D. McNutt card file T12N-R09W card # 101 at Tingley and Associates office
F. A. Palmer 1879 New bearing Tree
Maple 28" S14°W 28 links (18.48 feet)
Found stone and remains of Palmer's NBT of 1879

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
Searched the apparent location of the original corner, excavated 3.00 feet x 3.00 feet x 2.00 feet deep. Found ½" rerod 8" below road surface. Around the rerod were three stones, 6" x 8", 4" x 8" and 6" x 6" in size. There is an occupation tree line to the east.

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
Set remonumentation pipe in place of rerod and stones. Set stones around monument pipe.
- | | | | |
|------------------------------|-------|-------------|---|
| Set N/T N/S power pole | N87°W | 25.57 feet | ACCEPTED BY THE MONTCALM COUNTY SURVEY PEER GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 345 OF 1990 AT A MEETING HELD 11/26/00 |
| Set PK/T E/S power pole | N00°E | 199.85 feet | |
| Center S/S metal 3" post | S88°E | 34.38 feet | |
| Set PK/T S/S S/P elec. Panel | S67°W | 30.19 feet | |

This corner is accepted as the best available evidence of the position of the original corner.

WGT.
William Tingley, PS, Chairman

Bearings given are magnetic. Standard remonumentation pipe consists of a Berntsen stainless steel 2 3/8" x 30" pipe with a brass cap stamped "MONTCALM COUNTY REMONUMENTATION, P.S. # 30104"

Signed by William G. Tingley Date 10/26/00
Surveyor's Michigan License No. 30104

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983
ADAPTED FOR WORD PROCESSING MARCH, 1993



LIBER 4 PAGE 314

