


DEC 19 2000

MONTCALM COUNTY REMONUMENTATION PROGRAM
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

SECTION

For corners in Montcalm (County) Located in: Reynolds Township Corner Code #
1. Public Land Survey Sec. 5,8 T 12 N R 10 W D-03
2. Property Controlling in Section S T R
3. Miscellaneous Property in Sec. S T R
4. Lot No. Recorded Plat
5. Private Claims

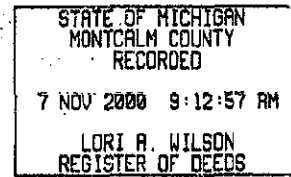

Register of Deeds Stamp & File Number

I, William G. Tingley, in a field survey on May 24, 2000 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- 1. October 1837, Abner E. VanNess, Deputy Surveyor, GLO notes, West corrected between sections 5 and 8. 40.02 chains (2641.32 feet) Set quarter section post Pine 10" N60°E 18 links (11.88 feet) Pine 12" S16°E 7 links (4.62 feet)
- 2. No date, R.D. McNutt personal card T12N-R10W at Tingley and Associates office. N 1/4 post section 8, gas pipe 3/4" x 48" Oak 6" S73°45'W 71.30 feet School house N55°30'E 161.00 feet
- 3. April 06, 1973, Sammy S. Barnett # 16923, LCRC Liber 001 Page 073 Found 1/2" pipe in C/L gravel E-W, 15 feet east of gravel south, inline with fence north W. oak 10" S01°E 82.05 feet T. pole S28°W 98.52 feet T. pole N50°W 53.75 feet W. pine 4" N15°W 29.59 feet
- 4. March 20, 1979, Duane F. Wood # 24625, LCRC Liber 002 Page 098 No evidence of original monuments or accessories found. Found Iron pipe. Pine 6" N15°W 29.33 feet Sign post S60°W 59.60 feet Oak 6" S65°E 73.58 feet
- 5. 1995, William G. Tingley # 30104, Field notes Job # 95349 1" iron pipe No witnesses given
- 6. August 23, 1995, Kevin Roosien # 31604, Certificate of Survey Liber 756 Page 901 3/4" pipe Nail W/S pine 18" N15W 29.49 feet Nail N/S poplar 10" S60°E 69.86 feet Nail SE/S oak 4" S45°W 89.35 feet Nail SW/S oak 24" N50°W 61.16 feet

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Searched the apparent location of the original corner, excavated 3.00 feet x 6.00 feet x 3.00 feet deep. Found 3/4" x 12" iron pipe 4" below road surface. No other evidence found. The corner is 19.00 feet east of C/L N-S road and on C/L E-W road.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- Set 3/4" iron pipe until roadwork is completed. Fnd nail N/S poplar 12" S56°E 69.83 feet Fnd nail SE/S oak 12" S43°W 89.35 feet Fnd nail SW/S oak stump 30" N38°W 61.19 feet Set N/T E/S fence post N06°E 33.73 feet SW cor. House # 22472 N60°E 161.00 feet



LIBER 4

PAGE 323



ACCEPTED BY THE MONTCALM COUNTY SURVEY PEEI GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 345 OF 1990 AT A MEETING HELD 10/26/00

William Tingley, PS, Chairman

This corner is accepted as the best available evidence of the position of the original corner.

Bearings given are magnetic. Standard remonumentation pipe consists of a Berntsen stainless steel 2 3/8" x 30" pipe with a brass cap stamped "MONTCALM COUNTY REMONUMENTATION, P.S. # 30104"

Signed by [Signature] Date 10/26/00