

SURVEY & REMONUMENTATION

DEC 23 1999

MONTCALM COUNTY REMONUMENTATION PROGRAM

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

SECTION

For corners in


Montcalm
(County)

Located in:

Reynolds Township

Corner Code #

1. Public Land Survey	Sec	T	R	Corner Code #
	26 & 27	12N	10W	I-10
		T	R	
		T	R	
		T	R	
2. Property Controlling in Section	S	T	R	
	S	T	R	
3. Miscellaneous Property in Sec.	S	T	R	
	S	T	R	

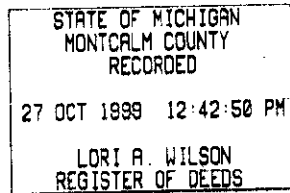

Register of Deeds Stamp & File Number

- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____

I, William G. Tingley a field survey on May 26, 1999, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

Oct. 19th, 1837, Abner E. Van Nifs, Deputy Surveyor, GLO Notes,
North between sections 26 and 27, 40.00 chains set quarter section post

- Pine 24" North 13 links
- Beech 10" S10°W 27 links

1982, June 1st, Glen Hackbardt, #25844, Survey #80139 West ¼ Corner Section 26, found 1 ¼" iron, Liber 547, Page 571.

- Oak Clump 5" N20°W 131.02 feet
- Double Oak 3" S15°W 49.85 feet
- Pine 5" S20°E 59.94 feet
- Abandoned Pole N60°W 46.83 feet

1982, June, Glen Hackbardt, #25844, Found 1 ¼" iron at road intersection, LCRC Liber 2 Page 09.

- Oak Clump 5" N20°W 131.02 feet
- Double Oak 3" S15°W 49.85 feet
- Pine 5" S20°E 59.94 feet
- Abandoned Pole N60°W 46.83 feet

1982, October 5th, Glen Hackbardt, #25844, Survey #78388, West ¼ Corner Section 26, found 1 ¼" iron Liber 551, page 712.

Same witness as June 1982, LCRC

1983, May 9th, Glen Hackbardt, #25844, Survey #80139-1, West ¼ Corner Section 26, found 1 ¼" iron, Liber 562, page 718.

Same witness as June 1982, LCRC

1988, May 17th, William Tingley, #30104, Survey #88064, West ¼ Corner Section 26, found 1 ¼" iron.

Same witness as June 1982, LCRC

1996, May 5th, William Tingley, #30104, Survey #96132, Government Corner Witnesses 1 ¼" iron on road intersection.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 1 ¼" iron 0.5' below gravel road surface, 1.5' below road surface found 2" round wooden post on west side of 1 ¼" iron located at road intersection.

- Found nail on SW side Abandoned Pole N60°W 46.3 feet
- Found nail SW side Oak 18" S20°W 49.8 feet

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set Remonumentation Monument over 1 ¼" iron.


- Found nail on SW side Abandoned Pole N60°W 46.3 feet
- Found nail on SE side of Light Pole S45°E 42.98 feet
- Found nail on SW side Oak 18" S20°W 49.8 feet
- Center Telephone Junction Box N30°E 62.8 feet

This corner is accepted as a careful and faithful perpetuation of the position of the original corner.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

ACCEPTED BY THE MONTCALM COUNTY SURVEY PEEF GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 345 OF 1990 AT A MEETING HELD 7/28/99

WGT
William Tingley, PS, Chairman

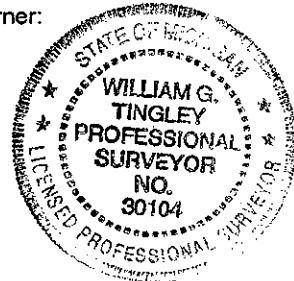

Signed by William Tingley Date 7/28, 1999

Surveyor's Michigan License No. 30104

