

MONTCALM COUNTY REMONUMENTATION PROGRAM
 LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970

SECTION


For corners in
Montcalm
 (County)

Located In: Reynolds Township Corner Code # _____

1. Public Land Survey	Sec	T	R	Corner Code #
	35 & 36	T 12N	R 10W	K-12
		T	R	_____
		T	R	_____
		T	R	_____
2. Property Controlling in Section	S	T	R	_____
	S	T	R	_____
3. Miscellaneous Property in Sec.	S	T	R	_____
	S	T	R	_____

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

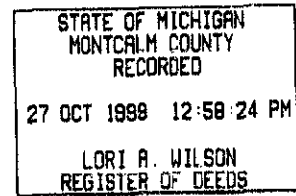

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, William G. Tingley a field survey on May 25, 1999, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- 1837, John Hodgson, Deputy Surveyor, GLO
 North between Sections 35 and 36, 40 chains Set Quarter Section Post
 Beech S60°W 19 links
 Beech N16°E 36 links
- 1982, June 15th, G. Hackbardt, #25844, Liber 2, Page 08
 Found 1 1/4" iron at road intersection.
 U.P. N35°W 26.51 feet
 U.P. S40°E 36.67 feet
 C.P. S20°W 78.80 feet
 SW Corner BlockHouse. N35°E 79.3 feet
- 5/21/96, William Tingley, #30104, Certificate of Survey found corner no witness.
- Found no other references.

ACCEPTED BY THE MONTCALM COUNTY SURVEY GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 345 OF 1990 AT A MEETING HELD 8/18/99

W.G.T.
 William Tingley, PS, Chairman

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Searched at apparent site, excavated 18" diameter by 3' deep hole, found 1" Iron pipe 20" long 0.4" below road surface found nothing below it. Distance to the South to K-13 2640.06', distance to the North to K-11 2638.59' These distance being close to the 2640 GLO distances excepted as the best available evidence of the original Corner.

Found PK Nail NE Side of Power Pole	N30°W	27.20 feet
Found PK Nail NE Side of Power Pole	S40°E	37.20 feet
Found PK Nail SE Side of Power Pole	S20°W	79.50 feet
Found SW corner house block foundation	N35°E	79.40 feet

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set Remonumentation Monument over 1" Iron Pipe

Found PK Nail NE Side of Power Pole	N30°W	27.20 feet
Found PK Nail NE Side of Power Pole	S40°E	37.20 feet
Found PK Nail SE Side of Power Pole	S20°W	79.50 feet
Found SW corner house block foundation	N35°E	79.40 feet



Bearings given are magnetic. Standard Monumentation consists of Berntsen Stainless Steel 30" x 2 3/8" pipe with brass cap stamped "Montcalm County Remonumentation" P.S. 30104.

Signed by William G. Tingley Date 8/18/99, 1999
 Surveyor's Michigan License No. 30104

