

MAR 10 2000

MARQUETTE COUNTY MICHIGAN RECEIVED FOR RECORD

1999 DEC 29 PM 2:45

SECTION

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Patricia A. Mosley REGISTER OF DEEDS

Table with columns: MARQUETTE (County), Located In, Corner Code #. Rows include Public Land Survey, Property Controlling in Section, and Miscellaneous Property in Sec.

LIBER R2 PAGE 240 Register of Deeds Stamp & File Number

L-1 [N1/4 COR SEC 1] L-3 [N1/4 COR SEC 12]

4. Lot No. , Recorded Plat 5. Private Claims

I, M.P. DAVIS, in a field survey on DECEMBER, 19 99 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.


Grid table with columns A-M and rows 1-13. Contains numbers 1-36 in a grid pattern.

A. Description of original monument and accessories and/or subsequent restoration:

- L-1 [N1/4 COR SEC 1] Wm. A. BURT, D.S.-1841-(CEDAR 06" N15°E 12 LINKS)(CEDAR 05" N36°W 19 LINKS) NO RECORD EVIDENCE OF CORNER RECOVERY AND/OR SUBSEQUENT REMONUMENTATION. L-3 [N1/4 COR SEC 12] E.C.MARTIN, D.S.-1852-WOOD POST (CEDAR 16" S66°W 34 LINKS)(TAMARACK 08" N60°W 12 LINKS) NO RECORD EVIDENCE OF CORNER RECOVERY AND/OR SUBSEQUENT REMONUMENTATION.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- L-1 [N1/4 COR SEC 1] NO CORNER EVIDENCE FOUND-REESTABLISHED CORNER POSITION ON LINE WITH NW CORNER OF SEC 2 AND NE CORNER OF SEC 1 AND IN LINE WITH C/L OF COUNTY ROADS NORTH AND SOUTH. ACCEPTED AS BEING THE BEST AVAILABLE EVIDENCE AS TO THE LOCATION OF THE POSITION OF THE ORIGINAL CORNER. L-3 [N1/4 COR SEC 12] NO CORNER EVIDENCE FOUND-REESTABLISHED CORNER POSITION AT JUNCTION OF FENCE LINES EAST AND SOUTH AND AT THE APPROXIMATE C/L INTERSECTION OF COUNTY ROADS NORTH & WEST. ACCEPTED AS BEING THE BEST AVAILABLE EVIDENCE AS TO THE LOCATION OF THE POSITION OF THE ORIGINAL CORNER.

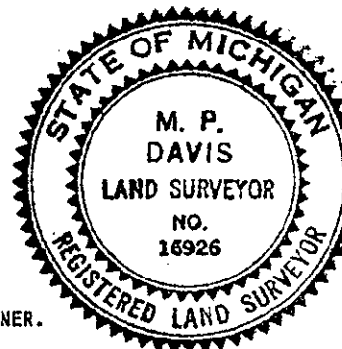

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- L-1 SET A 3/4" X 18" REBAR W/A 3-1/4" ALUM CAP STAMPED TO ID THE CORNER POSITION. SPRUCE 11" TAMARACK 07" TAMARACK 06" ELM 06" N55°W 78.70' N43°E 60.38' S50°E 69.63' S41°W 60.70' L-3 SET A 3/4" X 18" REBAR W/A 3-1/4" ALUM CAP STAMPED TO ID THE CORNER POSITION. SPRUCE 08" ELM 10" ELM 05" ELM 17" N22°W 102.80' EAST 46.10' S21°W 32.45' S84°W 17.53'

RATIFIED BY PEER GROUP P.A. 345 OF 1990

Larry J. Bussan DATE 12/27/99

NOTE: BEARINGS TO REFERENCE OBJECTS ARE MAGNETIC-DISTANCES ARE TO A NAIL IN THE C/L OF THE OBJECT, UNLESS OTHERWISE NOTED.

Signed by M.P. Davis Surveyor's Michigan License No. 16926

Date 12/14/99