

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

<u>Marquette</u>	Located In:	Corner Code #
(County)		
1. Public Land Survey	T <u>45N</u> R <u>30W</u>	<u>H4</u>
	T <u>    </u> R <u>    </u>	<u>    </u>
	T <u>    </u> R <u>    </u>	<u>    </u>
	T <u>    </u> R <u>    </u>	<u>    </u>
2. Property Controlling in Section	S <u>10</u> T <u>45N</u> R <u>30W</u>	<u>5</u>
	S <u>    </u> T <u>    </u> R <u>    </u>	<u>    </u>
3. Miscellaneous Property in Sec.	S <u>    </u> T <u>    </u> R <u>    </u>	<u>    </u>
	S <u>    </u> T <u>    </u> R <u>    </u>	<u>    </u>

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

Oct 16 2001

I, Stephan J. Szyszkoski, in a field survey on \_\_\_\_\_, 19\_\_\_\_ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

**NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.**

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6		5		4		3		2		1	
3												
4	7		8		9		●		11		12	
5												
6	18		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												


A. Description of original monument and accessories and/or subsequent restoration:  
 (H4) Center of Section 10. Not established in the original survey.  
 (5-Sec. 10) North 1/16 corner, Section 10. Not established in the original survey.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(H4) Established the corner at the intersection of straight lines connecting opposite Quarter corners. The corner falls in the approx. centerline of a woods road which bears WSW-ENE. Drove the monument to 0.4' below the road surface.  
 (5-Sec. 10) Established the corner midway and on a straight line between Center of Section 1335.04' South and Quarter corner 1335.04' north.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(H4) Set 1"IDx32" I. Pipe with 4" alum. MDNR cap. Blazed and scribed: 10" Sugar N24E 31.1'      "C1/4 BT" 13" Sugar S70E 27.2'      do 12" Sugar S32W 17.0'      do 8" Sugar N29W 14.2'      do Squared sugar post with location poster is S2W 6.4' and at the edge of woods road. Bearings are magnetic, Var. 10deg. W. Dist. to notch in lower blaze.	(5) Set 1"IDx32" I. Pipe with 4" alum. MDNR cap. Blazed and scribed: 16" Y. Birch N63E 9.4'      "1/16S BT" 8" Maple S01E 33.0'      do 12" W. Spruce N64W 7.9'      do 14" W. Pine N03W 37.0'      do Set sq'd tam. post adjacent. Bearings are magnetic. Var. 22 deg. West. Distances are to notch in lower blaze.
---	--

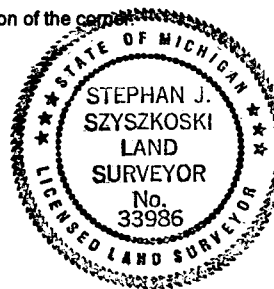

Signed by Stephan J. Szyszkoski Date 2/4/02  
 Surveyor's Michigan License No. 33986

For the Michigan Department of Natural Resources - Office of Property Management