SECTION

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

MARQUETTE COUNTY	,
RECEIVED FOR RECOR	ľ

1999 DEC 22 AN 11: 26

Patricis	d.	Man	lous
REGISTER	0F	DEEDS	1
			$\delta_{k_{r}}$

For corners in **MARQUETTE** Located In: Corner Code # 1. Public Land Survey T 46N R 25W 2. Property Controlling in Section 3. Miscellaneous Property in Sec. _ , Recorded Plat 5. Private Claims

LIBER R2 PAGE 212


Register of Deeds Stamp & File Number

GERALD W. CARLSON ___, in a field survey on _ May 14th , 19 99 , do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the comer points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration: I-1: Corner common to Sections 2 and 3, T46N-R25W on the North Township line. 1845: William Ives original subdivision survey notes describe the corner monument as a wood post 16 links West of corner of sections 34 and 35 T47N-R25W referenced by: 11" Sugar S05W, 10L 16" Sugar

No Date: A Mortgage Report by William R. Donnan, P.S.#17618, indicates a corner +/-2586' to the East 1/4 corner of Section 3.

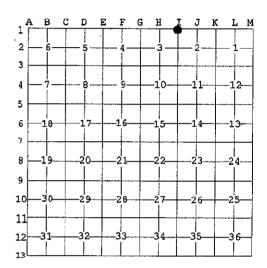

RATIFIED BY PEER GROUP P.A. 345 OF 1990

1990: A section breakdown sheet by Gerry Carlson, P.S.# 24589, indicates the corner distance S00-03-05W, 2609.80' to the East quarter corner of Section 3.

1990: A Survey sketch by Gerry Carlson, P.S.# 24589, indicates the corner distance 2609.80' to the East quarter corner of Section 3 and 10.55' East to a 1/2" RRC at the Southeast corner of Section 34, T47N-R25W.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I-1: 1999: No original corner evidence found. Found and accepted a 1/2" iron with P.S.#20711 cap on it, 11.3' West of centerline old County Road 503 Section 34, T47N-R25W, 4.5' North of centerline county road NA and 10.55' West of the Southeast corner of Section 34, T47N-R25W. Distance West is 2646.42', East is 2662.41'.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I-1: 1999: Replaced a 1/2" by 18" iron with P.S.#20711 cap on it with a 3/4" by 36" iron capped with a 3 1/4" diameter aluminum tablet Marquette County Survey Monument stamped to identify the corner. Monument is .35' below the road surface in a monument box. Referenced by:

10" Spruce

S62E.

Southwest building corner at foundation N57E. 90.71 85.34' to set double headed nail (no blazes, paint, or tag)

Northeast corner of Sands Township Hall Southeast corner section 34 monument

\$44W, N89E.

65.85 10.55

N40W.

Green Steel Sign Post w/ Yellow Survey Marker Sign

35.801

Bk.12 , Pg. 82

T46N-R25W

Corner Search Sheet

99100

GERALD W CARLSON SURVEYOR No.

Guald Wales

Surveyor's Michigan License No.