

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

(MARQUETTE COUNTY)

FOR CORNERS OF --	LOCATED IN --	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 46 <del>S.</del> N. R. 29 <del>E.</del> W.	#I-7
2. PROPERTY CONTROLLING IN SECTION	14, T. 46 N. <del>S.</del> R. 29 <del>E.</del> W.	#10
3. MISCELLANEOUS PROPERTY IN SECTION	T. N. R. E. S. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND  
FILING NUMBER

I, Arthur O. Enger, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on see below, 19\_\_\_\_, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

**Corner I-7 (Section Corner 14, 15, 22 & 23, T46N, R29W):**  
 Cedar post (Not found. No subsequent monuments found.)  
 W. Pine 24 S81W 18 (Probably found. No subsequent accessories found.)  
 Y. Birch 6 N21E 24 (Probably found. No subsequent accessories found.)

**Corner 10 (South 1/16 corner between Sections 14 & 15, T46N, R29W):**  
 Not established in original survey nor subsequently, apparently.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

**Corner I-7: Restored 10-3-79 from stumps corresponding to the original BT's in species, absolute and relative size, distance, and bearing, although both are in an advanced state of decomposition. Position checks with probable original line tree stumps 4.98 ch. S and 12.74 ch. N (actual distances as measured are 4.92 ch. and 12.84 ch., respectively) and with top of hill 21.00 ch. S (actual is 21.19 ch.)**

**Corner 10: Established 9-10-79 on line between 1/4 cor. 20.3205 ch. N and Sec. Cor. 20.3205 ch. S.**

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

**Corner I-7: 1" I.D. x 36" iron pipe with 3 3/4" aluminum cap, set in a rock mound.**  
 Red Maple 10 (1 of clump of 4) N54°E (mag.) 22.5 ft. "S14, NBT"  
 Red Pine 16 S38°E (mag.) 25.8 ft. "S23, NBT"  
 Declination 2° 00' West.

**Corner 10: 1" I.D. x 36" iron pipe with 3 3/4" aluminum cap.**  
 Tamarack 4 N72°E (mag.) 30.7 ft. "1/16S, BT"  
 Cedar 4 S15°E (mag.) 26.5 ft. "1/16S, BT"  
 Declination 2° 00' West.

SIGNED BY Carl R. Johnson DATE \_\_\_\_\_

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_


(SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY Carl R. Johnson DATE March 1980

APPROVED AND SIGNED BY Arthur O. Enger DATE March 7, 1980

MICHIGAN REGISTERED LAND SURVEYOR  
**Arthur O. Enger**  
 Michigan Department of Natural Resources

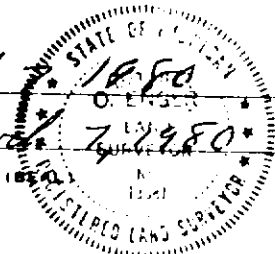

SURVEYOR'S MICHIGAN REGISTRATION NO. 13581