

SURVEY & REMONUMENTATION

MAY 22 1997

COMMISSION

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Marquette
(County)

Located In:

Corner Code #

- | | | | | | |
|---|---|------------|---|------------|-----------------|
| 1. Public Land Survey | T | <u>47N</u> | R | <u>23W</u> | <u>M8</u> |
| | T | <u>47N</u> | R | <u>22W</u> | <u>AB Alger</u> |
| | T | | R | | |
| | T | | R | | |
| 2. Property Controlling
In Section | S | | T | R | |
| | S | | T | R | |
| 3. Miscellaneous
Property in Section | S | | T | R | |
| | S | | T | R | |

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Robert L. Jamros, in a field survey on June 29, 1995, 19_____, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:


M8: PLS-William A. Burt, DS, 1841, Set Qr. Section Post- Hemlock 22", N.20 E., 11 links, Maple 14", N.64 W., 40 links. No Subsequent Restoration prior to 1973. Frank J. Bray, RLS, 1973, this corner was set mid-point and on line between section corners north and south. Established the following references. Hemlock 9", N.32 W., 29.3', Maple 12", S.64 W., 38.2'. Recorded in Filing No. 37, Alger County Records.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

M8: Found 1' galvanized iron pipe with 4" aluminum cap stamped to identify corner position. Corner position reestablished by single proportionate measurement by Frank J. Bray, RLS, 1973. A search was made at GLO bearing tree locations, no evidence found. Established additional reference trees. Corner position is accepted as a careful and faithful reestablishment of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

M8: Stamped P.A. 345 in existing 4" Aluminum capped Michigan D.N.R. Monument. Renewed existing reference trees w/ BT signs and paint. Established additional reference trees w/ BT signs, blazed, scribed and painted. Set PK nails for measure w/ Alum. I.D. washers in the following reference trees. Ex. Hemlock 14", N.26 W., 29.40 feet, " Dbl. Blz'd. ", Ex. Maple 16", S.70 W., 38.65 feet, " Dbl. Blz'd. ", Maple 12", N.69 E., 31.98 feet, " 1/4s BT ", Maple 13", S.25 E., 23.48 feet, " 1/4s BT ", Survey Marker sign on six foot steel post, S.52 E., 0.8 feet. All bearings are magnetic.

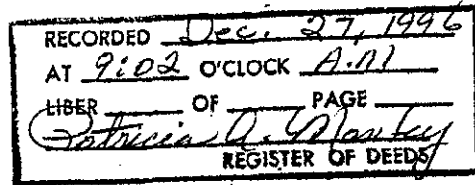

LIBER **1** PAGE **38t**

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L
2	6		5		4		3		2			
3												
4	7		8		9		10		11		12	
5												
6	18		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												

Signed by Robert L. Jamros
Surveyor's Michigan License No. 25849



RATIFIED BY PEER GROUP
P.A. 345 OF 1990

Larry J. Bussard
DATE 12/14/96

12 December 1995