

SURVEY & REMONUMENTATION

OCT 26 1993

COMMISSION

Approved by Menominee County
Land Survey Remonumentation
Peer Group Under Act 345 Of

P.A. Of 1990 On Sept 16, 19993


LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

Chairman

For corners in

<u>MENOMINEE</u> <small>(County)</small>	Located In:	Corner Code #/
1. Public Land Survey	T <u>32</u> NR <u>27</u> W	<u>G-5</u>
	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
2. Property Controlling in Section	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

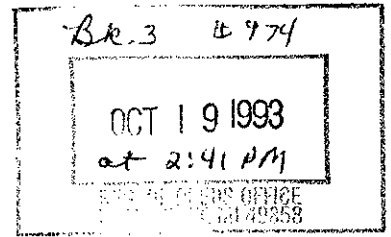

Register of Deeds Stamp & File Number

I, William Lenca, in a field survey on July, 1993, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5							●						
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:


ORIGINAL B.T.'s:

- Aspen, 24", S20°E, 35 lks
- Cedar, 10", N73°E, 08 lks

Original Survey by James H. Mullett in 1848. All original evidence for this corner has been destroyed by county road improvements.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found a P.K. nail set in place of a Berntsen HDR Monument destroyed in county road improvements. The monument was placed by George B. Wilson, RLS 17607, in a 1984 survey. The corner falls in the centerline of Elmwood Road (E-W) and in line with old fence lines to the North and South, and is accepted as the best available evidence of the position of the original corner.

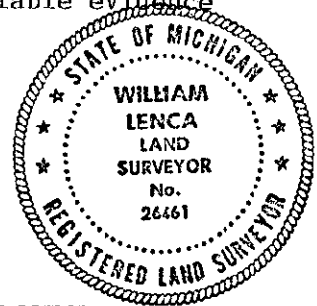

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 5/8" x 24" Iron Rod/3/4" Alum. cap stamped for corner in Monument Box.

- | | | |
|--|---------|------------|
| 5/8" x 24" Iron Rod/2" Alum. cap @ Steel Sign Post | - North | 28.24 feet |
| 5/8" x 24" Iron Rod/2" Alum. cap | - N59°E | 48.47 feet |
| 5/8" x 24" Iron Rod/2" Alum. cap | - S30°E | 46.63 feet |
| 16" dia. Maple | - S69°W | 62.56 feet |

NOTE: All bearings are magnetic bearings; distances are measured with steel tape.

Signed by William Lenca
Surveyor's Michigan License No. 26461

Date Sept. 10, 1993