

SURVEY & REMONUMENTATION

FEB 11 1998

Approved by Menominee County
Land Survey Remonumentation
Peer Group Under Act 345 Of
P.A. of 1990 On 10/31 1992
Mr. David DRS
Chairman

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

SECTION
For corners in
MENOMINEE
(County)

Located in: Corner Code #

1. Public Land Survey T32N R28W M-3 ✓
T32 R27 A-3
 2. Property Controlling in Section S T R
 3. Miscellaneous S T R
 Property in Sec. S T R

97 NOV 21 PM 3:19
DAVID DRS
REGISTERED LAND SURVEYOR
NO. 20461

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____
 SAME AS CORNER A-3, T32N-R27W

I, William Lenca, in a field survey on Mar. 30, 1997 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

1847: Original Survey by John Mullett - B.T.'s - Cedar, 12" - N50°W - 20 lks.; Cedar, 11" - S43°W - 15 lks. No original evidence for this corner was recovered.


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

This corner was re-established at a single proportional location between the NE Corner (M-1) of Section 1 and the E1/4 Corner (M-4) of Section 12, T32N-R28W, and is accepted as a careful and faithful reestablishment of the position of the original corner. This corner falls in a large tag alder and tamarack swamp - there is no evidence of occupation in the area.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 3/4" x 4" long aluminum rod/3-1/4" dia. Alum. cap stamped for corner:

9" dia. Tamarack	N03°E	25.75 feet	Scr. NBT
8" dia. Maple	S60°E	15.65 feet	Scr. NBT
5" dia. Maple	S35°W	12.85 feet	Scr. NBT
12" dia. Maple	N63°W	19.87 feet	Scr. NBT
Metal Survey Sign Post	South	1.0 feet	

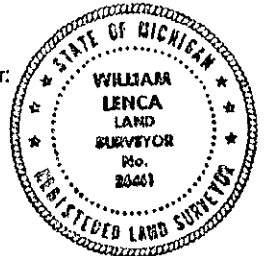

NOTE: All bearings are magnetic bearings. All distances are measured with steel tape. Distances to trees are to nail in side of tree.

Signed by William Lenca 20461
 Surveyor's Michigan License No. _____

Date Apr. 08, 1997

544