

LAND CORNER RECORDATION CERTIFICATE  
 Filing Requirement of Act 74, Mich. P.A. 1970

For corners in  
MENOMINEE  
 (County)

	Located In:	Corner Code #
1. Public Land Survey	T <u>33N</u> R <u>R27W</u>	<u>E06</u>
	T <u>   </u> R <u>   </u>	<u>   </u>
	T <u>   </u> R <u>   </u>	<u>   </u>
	T <u>   </u> R <u>   </u>	<u>   </u>
2. Property Controlling in Section	S <u>   </u> T <u>   </u> R <u>   </u>	<u>   </u>
	S <u>   </u> T <u>   </u> R <u>   </u>	<u>   </u>
3. Miscellaneous Property in Sec.	S <u>   </u> T <u>   </u> R <u>   </u>	<u>   </u>
	S <u>   </u> T <u>   </u> R <u>   </u>	<u>   </u>

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

Chairman  
 6 DEC 30 11 09 AM  
 470 BK 5  
 ARBARA KOPPELSON  
 REGISTERED LAND SURVEYOR

Register of Deeds Stamp & File Number

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	10	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, William Lenca, in a field survey on Dec 18, 1996 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:


- 1848: Original Survey by John Mullett - B.T.'s - Hemlock, 8" - S63°E - 08 lks.; Cedar, 8" - S81°W - 11 lks. All original evidence for this corner has been destroyed by logging activities.
- 1983: CERTIFIED SURVEY No. 341 by George B. Wilson, RLS No. 17607, shows this corner as it relates to other corners in Section 16, T33N-R27W. No corner monument is described, and no B.T.'s are given. The corner is shown as M.P.O.L.
- 1990: L.C.R.C. No. 893 by William Lenca, RLS No. 26461, states "Found 5/8" iron rod/squared wood post established by George B. Wilson in survey of Sec. 16, T33N-R27W - corner is very close to single proportionate position." B.T.'s: 12" W. Ash - N31°E - 43.91'; 7" W. Ash - S50°E - 7.65'; 8" W. Ash - S29°W - 26.96'; 6" W. Ash (s/b Elm) - N64°W - 10.65'.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

We recovered a 5/8" diameter iron rod and squared wood post at a single proportionate position between the Northwest Corner (E-5) and the Southwest Corner (E-7) of Section 16. We also recovered 4 B.T.'s described in L.C.R.C. No. 893 (see part "A") and accepted the location of the existing iron as a careful and faithful reestablishment of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- Set 2" dia. Aluminum Pipe/3-1/4" dia. Alum. cap stamped for corner location:
- |                         |       |            |          |
|-------------------------|-------|------------|----------|
| 12" dia. White Ash (Ex) | N31°E | 43.82 feet | Scr. NBT |
| 9" dia. White Ash (Ex)  | S50°E | 7.73 feet  | Scr. NBT |
| 8" dia. White Ash (Ex)  | S29°W | 26.99 feet | Scr. NBT |
| 8" dia. Elm             | N64°W | 10.58 feet | Scr. NBT |
| Metal Survey Sign Post  | East  | 2.05 feet  |          |

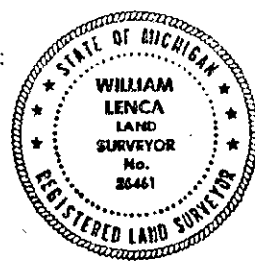

NOTE: All bearings are magnetic bearings. All distances are measured with steel tape. Distances to trees are to nail in side of tree.

Signed by William Lenca  
 Surveyor's Michigan License No. 26461

Date Dec. 19, 1996

470