

SURVEY & REMONUMENTATION

JAN 09 2001

SECTION

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

Approved by Menominee County
Land Survey Remonumentation
Peer Group Under Act 345 of
P.A. Of 1990 On 7/13, 2000
MCDONALD RGS
Chairman

For corners in
MENOMINEE


(County)

Located In:

Corner Code #

1. Public Land Survey	T <u>35</u> N R <u>26</u> W	C-8	
	T ___ R ___	_____	_____
	T ___ R ___	_____	_____
	T ___ R ___	_____	_____
2. Property Controlling in Section	S ___ T ___ R ___	_____	_____
	S ___ T ___ R ___	_____	_____
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	_____	_____
	S ___ T ___ R ___	_____	_____

Book 6 Page 141

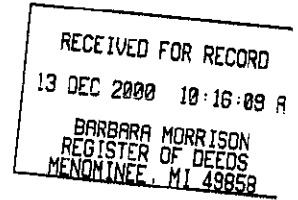

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, William Lenca, in a field survey on July, 1900 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6		5		4		3		2		1	
3												
4	7		8		9		10		11		12	
5												
6	10		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												

A. Description of original monument and accessories and/or subsequent restoration:

- 1848: Original Survey by James H. Mullett - B.T.'s - Hemlock, 12" - S63° W - 13 lks.; Maple, 12" - N75°E - 22 lks. All original evidence for this corner has been destroyed by County Road improvements.
- 1980: L.C.R.C. No. 262, Book 1, by Gerald W. Carlson, RLS No. 24589 states " Fd. 1/2" x 1" Iron bar 8" below blktop road in centerline 4-way intersection." TIES: Power Pole - N48°W - 47.57'; Elm 24" - N19°E - 91.17'; Guy Pole - N58°E - 55.46'; Ash 10" - S15°E - 79.28'.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

We found a 1/2 inch x 1 inch iron bar in the centerline with the centerline of county roads running North - South and East - West, along the the ties as described in L.C.R.C. No. 262, Book 1 (see part A). This position fits well with measurements to corners 1/2 mile North and 1/2 mile South, has been accepted and used by local surveyors for over 20 years, and is accepted as the best available evidence of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 5/8" x 24" Iron Rod/3-1/4" dia. Alum. cap stamped for corner location in Monument Box:

12" White Ash	N75°E	96.7 feet	Scr. NBT
14" White Ash	S17°E	79.17 feet	Scr. NBT
5/8" x 24" Iron Rod/2" dia. Alum. cap marked "WITNESS MARKER"	S47°W	34.29 feet	at Survey Sign Post
5/8" x 24" Iron Rod/2" dia. Alum. cap marked "WITNESS MARKER"	N46°W	48.59 feet	1.2' W of PP
Metal Survey Sign Post	S47°W	35 feet	

NOTE: All bearings are magnetic bearings. All distances are measured with steel tape. Distances to trees are to nail in side of tree.

Signed by William Lenca
Surveyor's Michigan License No. 26461

Date Aug. 8, 2000

