

SURVEY & REMONUMENTATION

JAN 09 2001

SECTION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

Approved by Menominee County
Land Survey Remonumentation
Peer Group Under Act 345 of
P.A. of 1990 On 7/13, 2000
MCL DAVIS RUS
Chairman

For corners in
MENOMINEE


(County)

Located in:

Corner Code #

1. Public Land Survey	T <u>35</u> N R <u>26</u> W	D-9	
	T ___ R ___		
	T ___ R ___		
	T ___ R ___		
2. Property Controlling in Section	S ___ T ___ R ___		
	S ___ T ___ R ___		
3. Miscellaneous Property in Sec.	S ___ T ___ R ___		
	S ___ T ___ R ___		

Book 6 Page 146

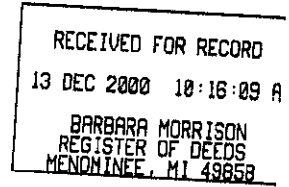

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, William Lenca, in a field survey on Sep., 1900 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9				●									
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:

1848: Original Survey by James H. Mullett - B.T.'s - Hemlock, 8" - N45°E - 18 lks.; Hemlock, 12" - S53°W - 24 lks.; All original evidence for this corner has been destroyed by County Road improvements.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

We set this corner in line with County Road centerlines East - West and the extension North of a county Road centerline South and in line with an old fence line running North. This position fits well with measurements to corners 1/2 mile East (2596.12 feet) and 1/2 mile West (2600.25 feet) and is accepted as the best available evidence of the position of the original corner.



C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 5/8" x 24" Iron Rod/3-1/4" dia. Alum. cap stamped for corner location in Monument Box:

5/8" x 24" Iron Rod/2" dia. Alum. cap marked "WITNESS MARKER"	N69°E	78.57 feet	1.0' West of 20" Elm
5/8" x 24" Iron Rod/2" dia. Alum. cap marked "WITNESS MARKER"	South	34.65 feet	at Survey Sign Post
5/8" x 24" Iron Rod/2" dia. Alum. cap marked "WITNESS MARKER"	N48°W	52.79 feet	1.0' South of 12" Spruce
5/8" x 24" Iron Rod/2" dia. Alum. cap marked "WITNESS MARKER"	N04°W	30.19 feet	1.0' North of Tel. Box
Metal Survey Sign Post	South	35.7 feet	

NOTE: All bearings are magnetic bearings. All distances are measured with steel tape. Distances to trees are to nail in side of tree.

Signed by William Lenca
Surveyor's Michigan License No. 26461

Date Oct. 13, 2000

1012