

Approved by Menominee County
 Land Survey Remonumentation
 Peer Group Under Act 345 Of
 P.A. Of 1990 On 10/26 19995
Mc. Anzil PLS
 Chairman

LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>MENOMINEE</u>	Located In:	Corner Code #/
Public Land Survey	T <u>35N</u> R <u>27W</u>	<u>H-1</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
Property Controlling in Section	S _____ T _____ R _____	_____
Miscellaneous	S _____ T _____ R _____	_____
Property in Sec.	S _____ T _____ R _____	_____

RECEIVED FOR RECORD
 95 NOV -8 AM 11:30
 PAGE # 229 BK 4
 BARBARA JOHNSON
 REGISTERED DEEDS
 MENOMINEE COUNTY
 19950

Register of Deeds Stamp & File Number

Lot No. _____, Recorded Plat _____
 Private Claims _____

(Also H-13 T36N-R27W)

William Lenca, in a field survey on Jul 12, 1995
 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

Description of original monument and accessories and/or subsequent restoration:

1847: Original Survey by H. Floyd (Township Exterior) - B.T.'s - Cedar, 10 - N32°E - 46 lks; Hemlock, 20" - N45°W - 48 lks. All original evidence has been destroyed by county road improvements.

Description of corner evidence found and/or method applied in restoring or reestablishing corner:


In a March 1995 survey of Section 3, T35N-R27W, we found a P.K. nail in the centerline of County Roads running East - West and North and in line with an old fence line running South. This corner location has been used by local surveyors for several years. The corner position fits well with existing lines of occupation and with other corners in the area, and is accepted as the best available evidence of the position of the original corner.

Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 5/8" x 24" Iron Rod/3-1/4" dia. Alum. cap stamped for corner location in Monument Box:

5/8" x 24" Iron Rod/2" dia. Alum. cap marked "WITNESS MARKER"	N52°E	56.37 feet
5/8" x 24" Iron Rod/2" dia. Alum. cap marked "WITNESS MARKER"	South	37.98 feet
5/8" x 24" Iron Rod/2" dia. Alum. cap marked "WITNESS MARKER"	N40°W	48.17 feet
Carsonite Survey Sign Post	South	38.4 feet

NOTE: All bearings are magnetic bearings. All distances are measured with a steel tape.

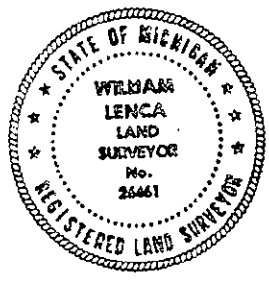

signed by William Lenca Date July 31, 1995
 Surveyor's Michigan License No. 26461

SURVEY &
 REMONUMENTATION
 DEPT. OF CONSERVATION