

Approved by Menominee County
 Land Survey Recommendation
 Peer Group Under Act 345 Of
 P.A. Of 1990 On 10/26 19995
Mc. Davis RLS
 Chairman

LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

MENOMINEE Located In: Corner Code ##
 (County)

1. Public Land Survey T 35N R 27W K-1
 T _____ R _____
 T _____ R _____
 T _____ R _____

2. Property Controlling S _____ T _____ R _____
 in Section S _____ T _____ R _____

3. Miscellaneous S _____ T _____ R _____
 Property in Sec. S _____ T _____ R _____

95 NOV -8 AM 11:31
 RECEIVED FOR RECORD
 PAGE # 239 BK 4
 DANIELA JOHNSON
 REGISTERED LAND SURVEYOR
 LICENSE NO. 26461

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____
 (T36N-R27W - K-13)

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	13	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, William Lenca, in a field survey on Aug. 31, 1995, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- 1847: Original Survey by H. Floyd (Township Exterior) - B.T.'s - Hemlock, 20 - N35°E - 20 lks; Lynn, 30" - N40°W - 36 lks.
- 1848: Original Survey by James H. Mullett (Sec. Subd.) - B.T.'s - Hemlock, 15" - S17°E - 20 lks; Hemlock, 18" - N62°W - 39 lks. All original evidence has been destroyed by County Road improvements.
- 1980: Certified Survey No. 176 recorded by George B. Wilson, RLS No. 17607, shows this corner as it relates to Corners J-13 (S1/4 Corner of Section 35, T36N-R27W) and Corner K-12 (E1/4 Corner of Section 35, T36N-R27W). No description of the corner monument is given, and no corner ties are shown.
- 1989: Certified Survey No. 657 recorded by William Lenca, RLS No. 26461, shows this corner as it relates to Corners L-1 and K-2, T35N-R27W. The corner monument is not described.


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

In an August, 1995 survey of Section 1, T35N-R27W, we recovered a boat spike in the centerline of County Road No. 358 (East - West) and in line with a County Road running North. The position of the boat spike matches record measurements shown in Certified Survey No.'s 176 and 657 to existing corners 1/2 mile East, West, North and South. This position has been used consistently for several years by local surveyors, and is accepted as the best available evidence of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 5/8" x 24" Iron Rod/3-1/4" dia. Alum. cap stamped for corner location in Monument Box:

- P.K. Nail in Power Pole N39°E 38.28 feet
- NE Corner of Old Cheese Factory Building S40°W 34.37 feet
- NW Corner of Old Cheese Factory Building S71°W 115.30 feet
- 5/8" x 24" Iron Rod/2" dia. Alum. cap marked "WITNESS MARKER" N34°W 53.18 feet
- Metal Survey Sign Post S49°E 45.1 feet

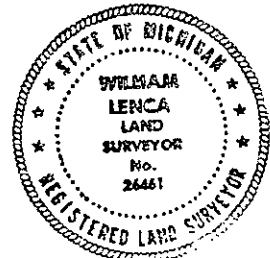

NOTE: All bearings are magnetic bearings. All distances are measured with a steel tape.

igned by William Lenca Date Sept. 06, 1995
 urveyor's Michigan License No. 26461

SURVEYED & RECOVERED
 RECORD 11/19/95